

NVIDIA MLNX_OFED Documentation v23.10-2.1.3.1-201 LTS

Table of contents

Release Notes	8
General Support	12
Changes and New Features	17
Bug Fixes in This Version	19
Known Issues	20
User Manual	69
Introduction	69
Installation	81
Features Overview and Configuration	82
Programming	82
InfiniBand Fabric Utilities	86
Troubleshooting	97
Common Abbreviations and Related Documents	98
Documentation History	102
Release Notes History	102
User Manual Revision History	102
Legal Notices and 3rd Party Licenses	107

List of Figures

Figure 0. Image2019 1 10 10 55 56 Version 1 Modificationdate 1717696668077 Api V2
Figure 1. Procedure Heading Icon Version 1 Modificationdate 1717696675727 Api V2
Figure 2. Procedure Heading Icon Version 1 Modificationdate 1717696675727 Api V2
Figure 3. Worddave635fed9c99097774044df72a47e9130 Version 1 Modificationdate 1717696689487 Api V2
Figure 4. Image2019 2 12 10 26 53 Version 1 Modificationdate 1717696701170 Api V2
Figure 5. Procedure Heading Icon Version 1 Modificationdate 1717696715483 Api V2
Figure 6. Procedure Heading Icon Version 1 Modificationdate 1717696718803 Api V2
Figure 7. Procedure Heading Icon Version 1 Modificationdate 1717696718803 Api V2
Figure 8. Procedure Heading Icon Version 1 Modificationdate 1717696730710 Api V2
Figure 9. Image2022 7 26 10 29 13 Version 1 Modificationdate 1717696749010 Api V2
Figure 10. Image2022 7 28 14 58 53 Version 1 Modificationdate 1717696747583 Api V2

Figure 11. lmage2022 7 28 15 0 34 Version 1 Modificationdate 1717696744987 Api V2
Figure 12. Image2022 7 28 14 59 57 Version 1 Modificationdate 1717696745870 Api V2
Figure 13. Image2022 7 28 15 1 11 Version 1 Modificationdate 1717696744527 Api V2
Figure 14. Image2022 7 28 15 1 42 Version 1 Modificationdate 1717696743363 Api V2
Figure 15. Image2022 7 28 15 2 14 Version 1 Modificationdate 1717696742737 Api V2
Figure 16. Image2022 7 28 15 4 11 Version 1 Modificationdate 1717696741613 Api V2
Figure 17. Image2022 7 28 15 6 40 Version 1 Modificationdate 1717696740657 Api V2
Figure 18. Procedure Heading Icon Version 1 Modificationdate 1717696823660 Api V2
Figure 19. Procedure Heading Icon Version 1 Modificationdate 1717696823660 Api V2
Figure 20. Procedure Heading Icon Version 1 Modificationdate 1717696823660 Api V2
Figure 21. Procedure Heading Icon Version 1 Modificationdate 1717696823660 Api V2
Figure 22. Procedure Heading Icon Version 1 Modificationdate 1717696823660 Api V2

Figure 23. Procedure Heading Icon Version 1 Modificationdate 1717696867847 Api V2
Figure 24. Procedure Heading Icon Version 1 Modificationdate 1717696867847 Api V2
Figure 25. Procedure Heading Icon Version 1 Modificationdate 1717696867847 Api V2
Figure 26. Procedure Heading Icon Version 1 Modificationdate 1717696867847 Api V2
Figure 27. Worddavb2ee67a7eb9aae5c536610e39a37dcc5 Version 1 Modificationdate 1717696884443 Api V2
Figure 28. Worddav6931c32564b3b0c166f4a26788219144 Version 1 Modificationdate 1717696882993 Api V2
Figure 29. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 30. Image2019 3 8 12 50 6 Version 1 Modificationdate 1717696879821 Api V2
Figure 31. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 32. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 33. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 34. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2

Figure 35. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 36. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 37. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 38. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 39. Procedure Heading Icon Version 1 Modificationdate 1717696881967 Api V2
Figure 40. Sriov Live Migration Stage 2 Version 1 Modificationdate 1717696888425 Api V2
Figure 41. Image2020 7 26 14 25 6 Version 1 Modificationdate 1717696893698 Api V2
Figure 42. Image2020 7 26 14 26 25 Version 1 Modificationdate 1717696894196 Api V2
Figure 43. Image2020 7 26 14 27 26 Version 1 Modificationdate 1717696896206 Api V2
Figure 44. Image2020 7 26 14 28 39 Version 1 Modificationdate 1717696898324 Api V2
Figure 45. Image2020 7 26 14 30 13 Version 1 Modificationdate 1717696898775 Api V2
Figure 46. Image2020 7 26 14 33 10 Version 1 Modificationdate 1717696899601 Api V2

Figure 47. Image2020 7 26 14 34 7 Version 1 Modificationdate 1717696900083 Api V2
Figure 48. Image2020 7 26 14 34 18 Version 1 Modificationdate 1717696901086 Api V2
Figure 49. Image2020 7 26 14 38 28 Version 1 Modificationdate 1717696901881 Api V2
Figure 50. Image2020 7 26 14 39 14 Version 1 Modificationdate 1717696903263 Api V2
Figure 51. Image2020 7 26 14 39 27 Version 1 Modificationdate 1717696904392 Api V2
Figure 52. Procedure Heading Icon Version 1 Modificationdate 1717696911668 Api V2
Figure 53. Worddav336f9b6791fd85e08c8e6897697cd75b Version 1 Modificationdate 1717696914279 Api V2
Figure 54. Procedure Heading Icon Version 1 Modificationdate 1717696920066 Api V2
Figure 55. Procedure Heading Icon Version 1 Modificationdate 1717696920066 Api V2
Figure 56. Procedure Heading Icon Version 1 Modificationdate 1717696920066 Api V2
Figure 57. Procedure Heading Icon Version 1 Modificationdate 1717696936560 Api V2

Overview

NVIDIA® OpenFabrics Enterprise Distribution for Linux (MLNX_OFED) is a single Virtual Protocol Interconnect (VPI) software stack that operates across all NVIDIA network adapter solutions.

NVIDIA OFED (MLNX_OFED) is an NVIDIA-tested and packaged version of OFED and supports two interconnect types using the same RDMA (remote DMA) and kernel bypass APIs called OFED verbs—InfiniBand and Ethernet. Up to 400Gb/s InfiniBand and RoCE (based on the RDMA over Converged Ethernet standard) over 10/25/40/50/100/200/400Gb/s are supported with OFED to enable OEMs and System Integrators to meet the needs of end users in the said markets.

Further information on this product can be found in the following MLNX_OFED documents:

- Release Notes
- User Manual

Software Download

Please visit <u>nvidia.com/en-us/networking</u> Products Software InfiniBand Drivers <u>NVIDIA MLNX OFED</u>

Document Revision History

For the list of changes made to the User Manual, refer to <u>User Manual Revision History</u>.

For the list of changes made to the Release Notes, refer to <u>Release Notes History</u>.

Release Notes



Info

This is a long-term support (LTS) release. LTS is the practice of maintaining a software product for an extended period of time (up to three years) to help increase product stability. LTS releases include bug fixes and security patches.

Release Notes Update History

Version	Date	Description
23.10-2.1.3.1.201	June 06, 2024	Initial release of this document version.

(i) Note

As of MLNX_OFED version v5.1-0.6.6.0, the following are no longer supported.

- ConnectX-3
- ConnectX-3 Pro
- Connect-IB
- RDMA experimental verbs libraries (mlnx_lib)

To utilize the above devices/libraries, refer to version 4.9 long-term support (LTS).

Release Notes contain the following sections:

- General Support
- Changes and New Features
- Bug Fixes in This Version
- Known Issues

Supported NIC Speeds

The Linux Driver operates across all NVIDIA network adapter solutions supporting the following uplinks to servers:

Uplink/Adapter Card	Driver Name	Uplink Speed
BlueField-2	mlx5	 InfiniBand: SDR, FDR, EDR, HDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE², 100GbE²
BlueField		 InfiniBand: SDR, QDR, FDR, FDR10, EDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE, 100GbE
ConnectX-7		 InfiniBand: EDR, HDR100, HDR, NDR200, NDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE², 100GbE², 200GbE ³, 400GbE
ConnectX-6 Lx		• Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE ²
ConnectX-6 Dx		• Ethernet: 10GbE, 25GbE, 40GbE, 50GbE ² , 100GbE ² , 200GbE ²

Uplink/Adapter Card	Driver Name	Uplink Speed
ConnectX-6		 InfiniBand: SDR, FDR, EDR, HDR Ethernet: 10GbE, 25GbE, 40GbE, 50GbE², 100GbE², 200GbE²
ConnectX- 5/ConnectX-5 Ex		 InfiniBand: SDR, QDR, FDR, FDR10, EDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE, 100GbE
ConnectX-4 Lx		• Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE
ConnectX-4		 InfiniBand: SDR, QDR, FDR, FDR10, EDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE, 56GbE¹, 100GbE

- 1. 56GbE is an NVIDIA proprietary link speed and can be achieved while connecting an NVIDIA adapter card to NVIDIA SX10XX switch series or when connecting an NVIDIA adapter card to another NVIDIA adapter card.
- 2. Speed that supports both NRZ and PAM4 modes in Force mode and Auto-Negotiation mode.
- 3. Speed that supports PAM4 mode only.

Package Contents

Package	Revision	Licenses
clusterkit	1.11.442-1.2310055	BSD
dpcp	1.1.43-1.2310055	BSD-3-Clause
hcoll	4.8.3223-1.2310055	Proprietary
ibarr	0.1.3-1.2310055	(GPL-2.0 WITH Linux-syscall-note) OR BSD-2-Clause
ibdump	6.0.0-1.2310055	BSD2+GPL2

Package	Revision	Licenses
ibsim	0.12-1.2310055	GPLv2 or BSD
ibutils2	2.1.1- 0.1.MLNX20240219.g79770a56.23 10213	Mellanox Confidential and Proprietary
iser	23.10-OFED.23.10.2.1.3.1	GPLv2
isert	23.10-OFED.23.10.2.1.3.1	GPLv2
kernel-mft	4.26.1-3	Dual BSD/GPL
knem	1.1.4.90mlnx3-OFED.23.10.0.2.1.1	BSD and GPLv2
libvma	9.8.40-1	GPLv2 or BSD
libxlio	3.20.8-1	GPLv2 or BSD
mlnx-en	23.10-2.1.3.0.g13ed7ba	GPLv2
mlnx-ethtool	6.4-1.2310055	GPL
mlnx- iproute2	6.4.0-1.2310055	GPL
mlnx-nfsrdma	23.10-OFED.23.10.2.1.3.1	GPLv2
mlnx-nvme	23.10-OFED.23.10.2.1.3.1	GPLv2
mlnx- ofa_kernel	23.10-OFED.23.10.2.1.3.1	GPLv2
mlnx-tools	24.01-0.2310213	GPLv2 or BSD
mlx-steering- dump	1.0.0-0.2310055	GPLv2
mpitests	3.2.21-8418f75.2310055	BSD
mstflint	4.16.1-2.2310055	GPL/BSD
multiperf	3.0-3.0.2310055	BSD 3-Clause, GPL v2 or later
ofed-docs	23.10-OFED.23.10.2.1.3	GPL/BSD
ofed-scripts	23.10-OFED.23.10.2.1.3	GPL/BSD
openmpi	4.1.7a1-1.2310055	BSD

Package	Revision	Licenses
opensm	5.17.0.1.MLNX20240219.0eca20cc -0.1.2310213	GPLv2 or BSD
openvswitch	2.17.8-1.2310213	ASL 2.0 and LGPLv2+ and SISSL
perftest	23.10.0-0.29.g0705c22.2310055	BSD 3-Clause, GPL v2 or later
rdma-core	2307mlnx47-1.2310213	GPLv2 or BSD
rshim	2.0.19-0.gbf7f1f2	GPLv2
sharp	3.5.1.MLNX20240219.7fcef5af- 1.2310213	Proprietary
sockperf	3.10-0.git5ebd327da983.2310055	BSD
srp	23.10-OFED.23.10.2.1.3.1	GPLv2
ucx	1.16.0-1.2310213	BSD
xpmem	2.7.3-1.2310055	GPLv2 and LGPLv2.1
xpmem-lib	2.7-0.2310055	LGPLv2.1

General Support

Supported Operating Systems

Operatin g System	Archi tectu re	Default Kernel Version (Primary)/ Tested with Kernel Version (Community)	OS Supp ort Mode I	ASAP ² OVS- Kernel SR-IOV	ASAP ² OVS- DPDK SR-IOV	NFS over RD MA	N V M e	GPUDir ect Storage (GDS)	UCX- CUD A Versi on
RHEL/Ro	AArc h64	4.18.0- 553.el8_10.aarch 64	Prim ary	•	8	8	•	•	12.2
cky8.10	x86_ 64	4.18.0- 553.el8_10.x86_6 4	Prim ary	•	8	•	•	•	12.2

Operatin g System	Archi tectu re	Default Kernel Version (Primary)/ Tested with Kernel Version (Community)	OS Supp ort Mode I	ASAP ² OVS- Kernel SR-IOV	ASAP ² OVS- DPDK SR-IOV	NFS over RD MA	N V M e	GPUDir ect Storage (GDS)	UCX- CUD A Versi on
RHEL/Ce	AArc h64	5.14.0- 427.13.1.el9_4.aa rch64	Prim ary	•	•	8	8	•	12.2
ntOS9.4	x86_ 64	5.14.0- 427.13.1.el9_4.x8 6_64	Prim ary	•	•	8	8	•	12.2

i) Note

- 32 bit platforms are no longer supported in MLNX_OFED
- For RPM-based distributions, to install OFED on a different kernel, create a new ISO image using mlnx_add_kernel_support.sh script (see the MLNX_OFED User Manual for instructions)
- Upgrading MLNX_OFED on a cluster requires upgrading all of its nodes to the newest version as well
- If using MLNX_OFED 4.9 LTS with MLNX_OFED 5.x with upstream verbs, MLNX_OFED 4.9 must be installed with --upstream-libs flag so the verbs libraries match.
- A combination of 4.9 LTS default verbs and MOFED 5.x upstream verbs is not supported.
- All operating systems listed above are fully supported in Paravirtualized and SR-IOV environments with Linux KVM Hypervisor

Upgrade/Downgrade Matrix

This section reflects which versions were tested and verified for upgrade and downgrade.

Target Version	Versions Verified for Upgrade/Downgrade	Release Type	Release Date
	5.8-4.1.5.0	GA-LTS- Update	December 2023
23.10-2.1.3.1 GA	23.10-1.1.9.0 - MLNX_OFED and DOCA-OFED Profile	GA-LTS- Update	November 2023
	23.10-0.5.5.0 - MLNX_OFED and DOCA-OFED Profile	GA-LTS-U0	October 2023

MLNX_OFED Version Interoperability

This section reflects which versions were tested and verified for multi-version environments.

Target Version	Verified OFED Version Interoperability	Release Type	Release Date
23.10-2.1.3.1	5.8-4.1.5.0	GA-LTS- Update	December 2023
GA	23.10-1.1.9.0	GA-LTS- Update	November 2023

Supported NIC Firmware Versions



Note

As of version 5.1, ConnectX-3, ConnectX-3 Pro or Connect-IB adapter cards are no longer supported. To work with a version that supports these adapter cards, please refer to version 4.9 long-term support (LTS).

This current version is tested with the following NVIDIA adapter card firmware versions:

Adapter Card	Bundled Firmware Version
BlueField®-2	24.39.3004
ConnectX-7	28.39.3004
ConnectX-6 Lx	26.39.3004
ConnectX-6 Dx	22.39.3004
ConnectX-6	20.39.3004
ConnectX-5/ConnectX-5 Ex	16.35.3006
BlueField	18.33.1048
ConnectX-4	12.28.2006
ConnectX-4 Lx	14.32.1010

For the official firmware versions, please see https://www.nvidia.com/en-us/networking/ Support Support Firmware Download.

Supported Non-Linux Virtual Machines

The following are the supported non-Linux Virtual Machines in this current version:

NIC	Windows Virtual Machine Type	Minimal WinOF Version	Protocol
ConnectX-4	Windows 2012 R2 DC	MLNX_WinOF2 2.50	IB, IPoIB, ETH
ConnectX-4 Lx	Windows 2016 DC	MLNX_WinOF2 2.50	IB, IPoIB, ETH
ConnectX-5 family	All Windows server	MLNX_WinOF2 2.50	IPoIB, ETH
ConnectX-6 family	editions	MLNX_WinOF2 2.50	IPoIB, ETH

Support in ASAP2—Accelerated Switch and Packet Processing®

ASAP ² Requirements	 iproute >= 4.12 (for tc support) Upstream Open vSwitch >= 2.8 for CentOS 7.2 NVIDIA openvswitch
ASAP2-Supported Adapter Cards	 ConnectX-5 ConnectX-6 Dx ConnectX-6 Lx ConnectX-7

Lustre Versions Compatible with MLNX_OFED

- Lustre 2.15.2
- Lustre 2.12.9

Hardware and Software Requirements

- Linux operating system
- Administrator privileges on your machine(s)
- Disk Space: 1GB

For the OFED Distribution to compile on your machine, some software packages of your operating system (OS) distribution are required.

To install the additional packages, run the following commands per OS:

Operating System	Required Packages Installation Command
RHEL/Oracl e Linux	yum install perl pciutils python gcc-gfortran libxml2-python tcsh libnl.i686 libnl expat glib2 tcl libstdc++ bc tk gtk2 atk cairo numactl pkgconfig ethtool lsof
XenServer	yum install perl pciutils python libxml2-python libnl expat glib2 tcl bc libstdc++ tk pkgconfig ethtool
SLES 12	zypper install pkg-config expat libstdc++6 libglib-2_0-0 lib- gtk-2_0-0 tcl libcairo2 tcsh python bc pciutils libatk-1_0-0 tk python-libxml2 lsof libnl3-200 ethtool lsof
SLES 15	python ethtool libatk-1_0-0 python2-libxml2-python tcsh lib- stdc++6-devel-gcc7 libgtk-2_0-0 tcl libopenssl1_1 libnl3-200 make libcairo2 expat libmnl0 insserv-compat pciutils lsof lib-glib-2_0-0 pkg-config tk

Operating System	Required Packages Installation Command
Ubuntu/De bian	apt-get install perl dpkg autotools-dev autoconf libtool auto- make1.10 automake m4 dkms debhelper tcl tcl8.4 chrpath swig graphviz tcl-dev tcl8.4-dev tk-dev tk8.4-dev bison flex dpatch zlib1g-dev curl libcurl4-gnutls-dev python-libxml2 libvirt-bin libvirt0 libnl-dev libglib2.0-dev libgfortran3 automake m4 pkg-config libnuma logrotate ethtool lsof

Unsupported Functionalities/Features/NICs

The following are the unsupported functionalities/features/NICs in the current version:

- ConnectX-2 adapter card
- ConnectX-3 adapter card
- ConnectX-3 Pro adapter card
- Connect-IB adapter card
- Soft-RoCE
- RDMA experimental verbs library (mlnx_lib)
- CIFS (Common Internet File System) module installation
- Relational Database Service (RDS)
- mthca InfiniBand driver
- Ethernet IPoIB (eIPoIB)

Changes and New Features

New Features

The following are the new features and changes that were added in this version. The supported adapter cards are specified as follows:

Supported Cards	Description
All HCAs	Supported in the following adapter cards <u>unless specifically</u> <u>stated otherwise:</u> ConnectX-4/ConnectX-4 Lx/ConnectX-5/ConnectX-6/ConnectX-6 Dx/ConnectX-6 Lx/ConnectX-7/BlueField-2
ConnectX-6 Dx and above	Supported in the following adapter cards <u>unless specifically</u> <u>stated otherwise:</u> ConnectX-6 Dx/ConnectX-6 Lx/ConnectX-7/BlueField-2
ConnectX-6 and above	Supported in the following adapter cards <u>unless specifically</u> <u>stated otherwise:</u> ConnectX-6/ConnectX-6 Dx/ConnectX-6 Lx/ConnectX-7/BlueField-2
ConnectX-5 and above	Supported in the following adapter cards <u>unless specifically</u> <u>stated otherwise:</u> ConnectX-5/ConnectX-6/ConnectX-6 Dx/ConnectX-6 Lx/ConnectX-7/BlueField-2
ConnectX-4 and above	Supported in the following adapter cards <u>unless specifically</u> <u>stated otherwise:</u> ConnectX-4/ConnectX-4 Lx/ConnectX-5/ConnectX-6/ConnectX-6 Dx/ConnectX-6 Lx/ConnectX-7/BlueField-2

Feature/Change	Description
	23.10-2.1.3.1.201
General	
Operating Systems	Added support for RHEL8.10 and RHEL9.4 at GA level. For the complete list of the OSes supported in the 23.10-2.1.3.1 version, see section General Support.

For additional information on the new features, please refer to the <u>MLNX_OFED User Manual</u>.

API Changes in MLNX_OFED

MLNX_OFED Verbs API Migration

As of MLNX_OFED v5.0 release (Q1 of the year 2020), MLNX_OFED Verbs API have migrated from the legacy version of user space verbs libraries (libibervs, libmlx5, etc.) to the Upstream version rdma-core.

For the list of MLNX_OFED verbs APIs that have been migrated, refer to <u>Migration to</u> RDMA-Core document.

Bug Fixes in This Version

Below are the bugs fixed in this version. For a list of fixes previous version, see <u>Bug Fixes History</u>.

Internal Reference Number	Description		
	Description: Resolved a discalculation issue where more Q-counters were freed than allocated when moving to switchdev mode.		
3729466	Keywords: Q-counters, switchdev		
	Discovered in Release: 23.10-1.1.9.0		
	Fixed in Release : 23.10-2.1.3.1		
	Description: Fixed an issue that allowed concurrent creation of encap entries, and could potentially cause double free vulnerabilities.		
3727822	Keywords: encap entries, double free		
	Discovered in Release: 23.10-1.1.9.0		
	Fixed in Release : 23.10-2.1.3.1		
	Description: Fixed an issue that exposed debugfs entries for non supported RoCE general parameters, such as rtt_resp_dscp.		
3728381	Keywords: debugfs, RoCE		
	Discovered in Release: 23.10-1.1.9.0		
	Fixed in Release : 23.10-2.1.3.1		

Internal Reference Number	Description
3710957	Description: Fixed an issue that triggered an error message by updating the rule actions STE apply flow. Following the update, the flow checks if the rule domain is different from the ASO CT action domain when applying the ASO CT action.
	Keywords: Software Steering
	Discovered in Release: 23.10-1.1.9.0
	Fixed in Release : 23.10-2.1.3.1

Known Issues

The following is a list of general limitations and known issues of the current version of the release.

Internal Ref. Number	Issue
	Description: On 64k page size systems, applications that open a large number of RDMA resources (UARs/QPs/CQs etc.) might face errors creating those resources due to a PCI BAR size limitation.
2546669	Keywords: PCI BAR size limitation
3546668	Workaround: It is recommended to increase the BAR size via mlxconfig to allow enough space for the allocation of all the needed RDMA resources.
	Discovered in Release: 23.10-1.1.9.0
	Description: When attempting to restart drivers using openIbd service while the nvme_rdma module is loaded, the process may fail. This behavior is intentional, as unloading nvme_rdma during the driver restart can lead to connectivity issues in other applications within the setup.
	Keywords: openIbd service, nvme_rdma module

Internal Ref. Number	Issue
	Workaround: Manually unload the nvme_rdma module before performing the driver restart. This can be achieved using the modprobe -r nvme_rdma command.
	Discovered in Release: 23.10-1.1.9.0
	Description: When using kernel version 4.12 or above, it is advised to run echo 0 > /sys/bus/pci/devices/0000\:08\:00.0/sriov_drivers_autoprobe to avoid VF probing
3676223	Keywords: VF probing
	Workaround: N/A
	Discovered in Release: 23.10-1.1.9.0
	Description: While using the RDMA-CM user application and the AF_IB parameter, the kernel uses only the first byte of the private data to set the CMA version. In such scenario, any user data written to this byte will be overwritten.
3682658	Keywords: RDMA-CM user application, AF_IB, private data
	Workaround: Do not use AF_IB for application's private data.
	Discovered in Release: 23.10-0.5.5.0
3640082	Description: A potential null pointer dereference might occur due to a missing update in the PCI subsystem code when creating the maximum number of VFs. All kernel versions lacking the following fix are impacted: "PCI: Avoid enabling PCI atomics on VFs."
	Keywords: Maximal VF number
	Workaround: N/A
	Discovered in Release: 23.10-0.5.5.0
3653417	Description: When offloading IPsec policy rules while in legacy mode there are two options:
	Software steering - The software stack will handle the task, and no device offload will take place.

Internal Ref. Number	Issue
	2. Changing the steering mode to firmware steering will return unsupported.
	Keywords: IPsec, legacy mode
	Workaround: Perform a devlink reload after changing the steering mode.
	Discovered in Release: 23.10-0.5.5.0
	Description: Currently, either IPsec offload or TC offload for a specific interface is allowed. The offloading TC rule to an interface will fail if an IPSec rule is already offloaded on it, and vice-versa.
3612274	Keywords: IPsec offload, TC offload
	Workaround: N/A
	Discovered in Release: 23.10-0.5.5.0
	Description: OVS mirroring of both egress and ingress together with modified TTL is not supported by Connectx-5 cards, and may cause packets checksum issues and errors in the dmesg command.
3596126	Keywords: OVS mirroring, Connectx-5
	Workaround: N/A
	Discovered in Release: 23.10-0.5.5.0
	Description: A Kernel ABI problem in Sles15SP4 may lead to issues during driver start. This impacts kernels starting from version 5.14.21-150400.24.11.1 up to version 5.14.21-150400.24.63.1 (July 2022 to May 2023), inclusive. For more information, see https://www.suse.com/support/kb/doc/?id=000021137 .
3538463	Keywords: Kernel ABI, Sles15SP4, driver start
	Workaround: Upgrade to a kernel version newer than 5.14.21-150400.24.63.1 (May 2023).
	Discovered in Release: 23.10-0.5.5.0
3637252	Description: When running over REHL7.6 with excessive RDMA/RoCE workload, kernel warnings may be triggered.

Internal Ref. Number	Issue
	Keywords: REHL7.6, RDMA, RoCE
	Workaround: N/A
	Discovered in Release: 23.10-0.5.5.0

Internal Ref. Number	Issue
	Description: A package manager upgrade with zypper (on an SLES system) may prompt a question about vendor change from "Mellanox Technologies" to "OpenFabrics".
	Keywords: Installation, SLES
3046655	Workaround: Either accept the prompted change, or add the /etc/zypp/vendors.d/mlnx_ofed file with the following content: [main] vendors = Mellanox,OpenFabrics
	Discovered in Release: 23.07-0.5.0.0
	Description: The ConnectX-7 firmware embedded in this MLNX_OFED version cannot be burnt using the MLNX_OFED installer script.
	Keywords: ConnectX-7, MLNX_OFED installer script
3392477	Workaround: Please download and install the dedicated firmware from the web https://network.nvidia.com/support/firmware/connectx7ib/
	Discovered in Release: 23.07-0.5.0.0
3532756	Description: The kernel may crash when restarting the driver while IP sec rules are configured.
	Keywords: IP sec
	Workaround: Flush the IP sec configuration before reloading the driver: ip xfrm state flush ip xfrm policy flush
	Discovered in Release: 23.07-0.5.0.0

Internal Ref. Number	Issue
3472979	Description: When a large number of virtual functions are present, the output of the "ip link show" command may be truncated.
	Keywords: virtual functions, ip link show
	Workaround: N/A
	Discovered in Release: 23.07-0.5.0.0
	Description: When using the mlnx-sf script, creating and deleting an SF with the same ID number in a stressful manner may cause the setup to hang due to a race between the create and delete commands.
3413938	Keywords: Hang; mlnx-sf
	Workaround: N/A
	Discovered in Release: 23.07-0.5.0.0
	Description: Configuring Multiport Eswitch LAG mode can be performed only via devlink from this release onwards. The compat sysfs should not be used to configure mpesw LAG.
3461572	Keywords: Multiport Eswitch, compat sysfs, mpesw LAG
	Workaround: N/A
	Discovered in Release: 23.07-0.5.0.0
3464337	Description: Simultaneously adding or removing TC rules while operating on kernel version 6.3 could potentially result in stability issues.
	Keywords: ASAP, rules, TC
	Workaround: Make sure the following fix is part of the kernel: https://lore.kernel.org/netdev/20230504181616.2834983-3- vladbu@nvidia.com/T/
	Discovered in Release: 23.07-0.5.0.0
3469484	Description: Mirror and connection tracking (CT) offload actions are not supported simultaneously if the kernel version does not support hardware miss to TC actions. Thus, when performing a CT offload

Internal Ref. Number	Issue
	test, the actual number of offloaded connections may be lower than expected.
	Keywords: ASAP, CT offload
	Workaround: Make sure to have the following offending commit in the tree: net/sched: act_ct: offload UDP NEW connections Make sure to to have https://www.spinics.net/lists/stable-
	commits/msg303536.html in the kernel tree to fix this issue.
	Discovered in Release: 23.07-0.5.0.0
	Description: When performing a CT offload test, the actual number of offloaded connections may be lower than expected.
3473331	Keywords: ASAP, CT offload
	Workaround: N/A
	Discovered in Release: 23.07-0.5.0.0
3499413	Description: Due to the following kernel issue, under heavy load, some connections may not be offloaded, leading to performance issues: "net/sched: act_ct: offload UDP NEW connections."
	Keywords: ASAP, CT offload
	Workaround: N/A
	Discovered in Release: 23.07-0.5.0.0

Internal Ref. Number	Issue
3360710	Description: Configuring PFC in parallel to buffer size and prio2buffer commands may lead to misalignment between firmware and software in regards to receiving buffer ownership.
	Keywords: NetDev, PFC, Buffer Size, prio2buffer
	Workaround: First, configure PFC on all ports, and then perform other needed QoS (i.e., buffer_size or prio2buffer) configurations

Internal Ref. Number	Issue
	accordingly.
	Discovered in Release: 23.04-0.5.3.3
	Description: OpenSM may not be started automatically if chkconfig was not installed before OpenSM is installed. Note, however, that chkconfig will fail to install if the directory (rather than symbolic link to directory) /etc/init.d already exists (e.g., from a previous installation of MLNX_OFED).
3413879	Keywords: Installation, OpenSM, chkconfig
	Workaround: Install chkconfig before installing MLNX_OFED. If installing it fails, make sure /etc/init.d does not exist at the time of installing it.
	Discovered in Release: 23.04-0.5.3.3
	Description: On SLES 15.4, installing MLNX_OFED using a package repository (with zypper) may trigger an error message about missing dependency for 'librte_eal.so.20.0()(64bit)'. This is because the inbox package libdpdk-20_0 is being uninstalled as it is incompatible with the MLNX_OFED rdma-core packages.
3424596	Keywords: Installation, SLES 15.4
	Workaround: Uninstall the relevant packages: 'zypper uninstall libdpdk-20_0' before installing MLNX_OFED. This will also remove the inbox openvswitch package.
	Discovered in Release: 23.04-0.5.3.3
3433416	Description: On systems that were installed with MLNX_OFED 5.9 or older and include a CUDA package (ucx-cuda / hcoll-cuda), an upgrade to MLNX_OFED 23.04 using the package manager ("yum") method will fail. This is because MLNX_OFED up to 5.9 is built with CUDA 11. MLNX_OFED 23.04 is built with CUDA 12 and those CUDA versions are incompatible.
	Keywords: Installation, CUDA, yum
	Workaround: Remove CUDA packages included with OFED (ucx-cuda, hcoll-cuda) before upgrading. This will allow to upgrade MLNX_OFED

Internal Ref. Number	Issue
	regardless of CUDA version installed. To install them later, CUDA 12 must be installed on the system.
	Discovered in Release: 23.04-0.5.3.3
	Description: mlx-steering-dump is not supported on systems in which Python3 is not the default.
3420831	Keywords: mlx-steering-dump, Python3
	Workaround: N/A
	Discovered in Release: 23.04-0.5.3.3
	Description: If the underlying persistent device name exceeds 15 characters in length, the operating system will not be able to perform renaming (i.e., the device name will remain "eth").
	Keywords: Persistant Interface Names
3351989	Workaround: Add thecopy-ifnames-udev flag to the OFED installation command. Note that this flag is only applicable if the persistent name provided by the kernel, without the 'np' suffix, is 15 characters or fewer.
	Discovered in Release: 23.04-0.5.3.3

Internal Ref. Number	Issue
	Description: When working in legacy rq (striding rq off), with large MTU > 3712, a 10-20% degradation in performance might be seen when running UDP stream with 64 bytes message size.
3324094	Keywords: NetDev, MTU, UDP Stream
	Workaround: N/A
	Discovered in Release: 5.9-0.5.6.0
3313137	Description: Virtual Functions depend on Physical Functions for device access (e.g, firmware host PAGE management). In addition, VF may need to access safely the PF 'driver data' to use the command interface as in the VFIO usage to support live migration.

Internal Ref. Number	Issue
	While the PF is missing its driver, the VFs are completely unusable. As such, upon PF unload, the SR-IOV is disabled by the PF itself. This is the standard widely seen behavior in Linux drivers today.
	Keywords: Core, SR-IOV, VF, PF
	Workaround: N/A
	Discovered in Release: 5.9-0.5.6.0
3320947	Description: When the system is overloaded, there is a possibility that one hour will pass between the creation of DevLink port and it usage/assignment, due to some locking. This will trigger a trace starting with: "Type was not set for devlink port."
3320947	Keywords: Core, DevLink, System Overload
	Workaround: N/A
	Discovered in Release: 5.9-0.5.6.0
	Description: Installing OFED with Open vSwitch packages failed over Ubuntu22 OS with inbox Open vSwitch installed on it. Inbox Open vSwitch packages should be removed first.
3046222	Keywords: Installation, Ubuntu22
	Workaround: Usewith-openvswitch flag along with the installation command.
	Discovered in Release: 5.9-0.5.6.0
	Description: Devlink reload while deleting namespace may causes a deadlock on kernels older than Linux-6.0.
3262725	Keywords: Devlink, Namespace
	Workaround: N/A
	Discovered in Release: 5.9-0.5.6.0
3253255	Description: RHEL 7 does not include built-in support for Python3. There are two potential ways to install it, and both install a package with a different name: 1. EPEL for RHEL7: python36 2. Rhel extra repository

Internal Ref. Number	Issue
	Python3 support is needed for using Pyverbs and the Python support of Open vSwitch. MLNX_OFED assumes that on RHEL7.x, if using Python3, that python36 from EPEL is used (otherwise the optional Python3 support cannot be used).
	Keywords: RHEL7, Python3
	Workaround: To use Python3 support on RHEL7, install python36 from the RHEL7 EPEL repository.
	Discovered in Release: 5.9-0.5.6.0

Internal Ref. Number	Issue
	Description: On EulerOS 2.0SP11, installation with the yum method may fail with an error that mlnx-iproute2 is missing a dependency on libdb-5.3.so ()(64bit).
3215514	Keywords: Installation, EulerOS 2.0SP11, yum
3213314	Workaround: Install in advance the mlnx-iproute2 package with rpm and with thenodeps option. For example: rpm -Uvnodeps RPMS/mlnx-iproute2-5.19.0-1.58101.x86_64.rpm
	Discovered in Release: 5.8- 1.0.1.1
	Description: In old kernels, /etc/init.d/openibd stop will fail because of an existing TC rule. Because mlx5_ib is already unloaded, mlx5_core and mlx5_ib will be in an inconsistent state.
3191223	Keywords: ASAP ² , eSwitch, TC Rules
	Workaround: Set eSwitch mode to legacy before enabling SR-IOV or reload mlx5_core to change eSwitch mode to legacy.
	Discovered in Release: 5.8- 1.0.1.1
3199628	Description: ping -6 -i <interface name=""> is broken in v5.18.</interface>
	Keywords: NetDev, -i flag
	Workaround: In all operating systems that are running Kernel 5.18 and below, remove the -i flag.

Internal Ref. Number	Issue
	Discovered in Release: 5.8- 1.0.1.1
3002932	Description: Jumbo MTU must be set on all uplinks (i.e., uplinks of *_sf and *_sf_r) at all times.
	Keywords: NetDev, MTU, Uplink
	Workaround: Configure jumbo MTU (9216) on all uplink-related interfaces.
	Discovered in Release: 5.8- 1.0.1.1
	Description: The yum install method might be broken on installer regenerated withadd-kernel-support-build-only.
2420050	Keywords: Installation, yum
3130859	Workaround: Delete the original mlnx-ofed-all-5.* package and recreate the repository with: createrepo RPMS/
	Discovered in Release: 5.8- 1.0.1.1
3149387	Description: The package neohost-backend (included in MLNX_OFED) has a strict dependency on Python 2.7 and on the existance of /usr/bin/python. This dependency is because of a pre-installation test (which is a rather non-standard method) for /usr/bin/python will fail the installation if without Python 2.7. As a result, default installation of this on newer systems that do not have a default of Python 2 has been disabled. If there is an explicit request for this installation using the command-line optionwith-neohost-backend, this sanity check will be overriden and there will be an attempt to install it regardless. On newer systems, there is likely to not be /usr/bin/python even if Python 2 is installed; as such its installation will fail.
	Keywords: Installation, Python 2
	Workaround: If neohost-backend is needed on a newer system, install Python 2 in advance and create the symbolic link /usr/bin/python - > python2.
	Discovered in Release: 5.8- 1.0.1.1

Internal Ref.	Issue
Number	
3213777	Description: Oracle Enterprise Linux version 9.0 generates kernel module packages that have dependencies that are not provided by their own kernel RPM packages and thus are not installable.
	Keywords: Installation, Oracle Enterprise Linux v9.0
	Workaround: N/A
	Discovered in Release: 5.8- 1.0.1.1
	Description: Restart driver failes to load OFED modules after installing OFED on SLES15sp4 with errata kernel 5.14.21-150400.24.21-default.
3229904	Keywords: Installation
	Workaround: Install OFED withadd-kernel-support flag.
	Discovered in Release: 5.8- 1.0.1.1
	Description: VLAN naming is limited to 16 characters (like all other interface names). For names longer than 16 charachters, the kernel generates its own interface name VLAN (VID).
3189424	Keywords: Core, VLAN, Interface Name
3103424	Workaround: Select a name which complies to the 16-characters limitation.
	Discovered in Release: 5.8- 1.0.1.1
	Description: Creating external SFs on BF ARM when the host (x86) operating system does not support SFs may cause the host to crash.
3220855	Keywords: Core, Scalable Functions
	Workaround: N/A
	Discovered in Release: 5.8- 1.0.1.1
3239291	Description: In some topologies, like logical partitions, mlxfwreset is not supported.
	Keywords: Core, mlxfwreset
	Workaround: N/A

Internal Ref. Number	Issue
	Discovered in Release: 5.8- 1.0.1.1

Internal Ref. Number	Issue
3114823	Description: The first attempt to create a new iSER connection fails with the following messages in dmesg:
	iSCSI Login timeout on Network Portal <iser_target_ip_addr>:3260 isert: isert_get_login_rx: isert_conn 00000000e9239d52 interrupted before got login req</iser_target_ip_addr>
	After the error, the iSER Initiator connects to the Target successfully, but the memory allocated for the first connection is not freed correctly. As a result, the failed attempt also causes memory leakage.
	 kernel.org Kernel 5.18 RHEL 9.0 RHEL 8.6 Ubuntu 22.04 SLES 15 SP4
	The error happens due to a bug in the scsi_transport_iscsi module, which is not a part of MLNX_OFED. As such, the issue cannot be fixed in MLNX_OFED. The bug is already fixed in kernel 5.19 by the commit f6eed15f3ea7 ("scsi: iscsi: Exclude zero from the endpoint ID range").
	Workaround: Update the kernel if the above errors are experienced. If the issue is still reproduced after the kernel update, ask your distro support to apply the bug fix from the upstream kernel.
	Keywords: iSER Initiator
	Discovered in Release: 5.7-1.0.2.0
3096911	Description: Installing chkconfig on Rhel9.0 with OFED using yum failed (chkconfig creates /etc/init.d sym link and OFED creates files in this directory, causing a conflict).
	Workaround: Installing chkconfig before OFED.
	Keywords: Installation

Internal Ref. Number	Issue
	Discovered in Release: 5.7-1.0.2.0
3100544	Description: On a RHEL9.x system, in some cases where inbox modules do not match for the drivers being build, rebuilding the drivers (add-kernel-support) works, but fails to install the built package, with many errors such as: kernel(rdma_block_iter_next) = 0x8e7528da is needed by mlnx-ofa_kernel-modules-5.6-OFED.5.6.2.0.9.1.kver.5.14.0_70.13.1.el9_0.aarch64.aarch64 This was caused by a bug in the scripts that creates the Requires and Provides headers that is confused by dependencies between different modules of the same external package.
	Workaround: dnf install kernel-modules- # in case it is not the newest.
	Keywords: Installation, RHEL9.x
	Discovered in Release: 5.7-1.0.2.0
	Description: Building rdma-core package on Rocky 8.6 OS caused failure in OFED build.
3132158	Workaround: N/A
	Keywords: Installation
	Discovered in Release: 5.7-1.0.2.0
	Description: Python package is missing, need to install it manually.
2127440	Workaround: Install Python before starting the build.
3137440	Keywords: Installation, Python
	Discovered in Release: 5.7-1.0.2.0
3141506	Description: kernel-macros package does not support building with KMP enabled. KMP needs to be disabled.
	Workaround: Build and install MOFED with KMP disabled (without kmp flag).
	Keywords: Installation
	Discovered in Release: 5.7-1.0.2.0

Internal Ref. Number	Issue
3141506	Description: kernel-macros package does not support building with KMP enabled. KMP needs to be disabled.
	Workaround: Build and install MOFED with KMP disabled (without kmp flag).
	Keywords: Installation
	Discovered in Release: 5.7-1.0.2.0
	Description: Kernel module packaging is not supported in CtyunOS.
2420627	Workaround: N/A
3129627	Keywords: Installation
	Discovered in Release: 5.7-1.0.2.0
2971708	Description: For OSs in which Devlink supports setting roceenable/disable, both sysfs roce_enable show and sysfs roce_enable set are disabled, and the RoCE state must be managed exclusively via Devlink. The sysfs interface for roce-enable/disable will be removed entirely for these OSs in a future release. To determine if Devlink can be used to enable or disable RoCE, execute the following console command after starting OFED:
	devlink dev param show grep roce Devlink supports roce enable/disable if the following line is reflected in the output: name enable_roce type generic
	For OSs which do not allow enabling/disabling RoCE via Devlink, the sysfs interface behaves as in the previous 2 releases: 1. For OSs which have Devlink reload, but do not allow setting RoCE state via Devlink: sysfs roce_enable show works, as does sysfs roce_enable set, but Devlink reload must be performed after setting the RoCE state via sysfs in order to activate the desired roce state. 2. For OSs which do not have Devlink reload, RoCE state is managed only by the sysfs interface.

Internal Ref. Number	Issue
	'show' displays the RoCE state and 'set' sets the state and activates it. To determine if Devlink dev reload is supported, execute the following console command (using the bash shell): devlink dev help 2>&1 grep reload Reload is supported if the output is: devlink dev reload DEV [netns { PID NAME ID }]
	Workaround: N/A Keywords: Enabling/Disabling RoCE
	Discovered in Release: 5.7-1.0.2.0

Internal Ref. Number	Issue
2998194	Description: On some systems with many (e.g., 64) virtual functions (VFs) attached to a ConnectX interface, 'ip link' may give an error message: "Error: Buffer too small for object." This applies to both IP commands: the inbox iproute package in RHEL8.x and the mlnx-iproute2 package from MLNX_OFED. This is known to work well and not give an error in RHEL7.x kernel regardless of what user-space package is used (including user-space from RHEL8.x).
	Workaround: N/A
	Keywords: NetDev, RHEL, Virtual Functions
	Discovered in Release: 5.6-1.0.3.3
3045436	Description: Rebooting the host while the Arm is down may block the shutdown flow till the Arm is up.

Internal Ref. Number	Issue
	Workaround: Restart the driver on the host side before reboot.
	Keywords: Reboot, Arm
	Discovered in Release: 5.6-1.0.3.3
	Description:
	 When offload is enabled, removing a physical port from ovs-dpdk bridge requires restarting OVS service. Not doing so will result in wrong configuration of datapath rules. When offload is enabled, the physical port must be attached to a bridge.
3040350	Workaround:
	 When removing a physical port from an ovs-dpdk bridge while offload is enabled, need to restart openvswitch after reattaching it. Attach physical port to a bridge according to the desired topology.
	Keywords: OVS-DPDK, Bridge, Offload
	Discovered in Release: 5.6-1.0.3.3
	Description: dec_ttl only work with ConnectX-6. It does not work with ConnectX-5.
2973726	Workaround: N/A
	Keywords: OVS-DPDK, dec_ttl
	Discovered in Release: 5.6-1.0.3.3
2946873	Description: Moving to switchdev mode while deleting namespace may cause a deadlock.
	Workaround: Unload mlx5_ib module before moving to Switchdev mode.
	Keywords: ASAP ² , Switchdev, Namespace
	Discovered in Release: 5.6-1.0.3.3

Internal Ref. Number	Issue
	Description: If a system is run from a network boot and is connected to the network storage through an NVIDIA ConnectX card, unloading the mlx5_core driver (such as running '/etc/init.d/openibd restart') will render the system unusable and should therefore be avoided.
2811957	Workaround: N/A
	Keywords: Installation, mlx5_core
	Discovered in Release: 5.6-1.0.3.3
2979243	Description: The kernel in CentOS 7.6alt (for non-x86 architectures) is different than that of RHEL 7.6alt. Some of the MLNX_OFED kernel modules that were built for the RHEL7.6alt kernel will not load on a system with Centos7.6alt kernel. If you want to install MLNX_OFED on such a system, you should use ./mlnxofedinstalladd-kernelsupport to rebuild the kernel modules for the Centos kernel.
	Workaround: Use add-kernel-support.
	Keywords: Installation,CentOS
	Discovered in Release: 5.6-1.0.3.3
	Description: In Debian 11.2, Ubuntu 21.10, and Ubuntu 22.04, attempting to install an "exact" type of metapackage (such as mlnx-ofed-all-exact or mlnx-ofed-basic-exact) may fail with an error regarding the version of mstflint.
3011440	Workaround: Install also mstflint of the exact same version (e.g., apt install mlnx-ofed-all-exact mstflint=4.16.0-1.56xxxx).
	Keywords: Installation,Debian, Ubuntu, MST
	Discovered in Release: 5.6-1.0.3.3
3024520	Description: The optioncopy-ifnames-udev copy some files under /etc (/etc/udev/rules.d/82-net-setup-link.rules and /etc/infiniband/vf-net-link-name.sh) that are never removednot in the case this option is not given and not upon uninstallation. Those scripts are merely examples. They are files under /etc to be maintained by the user.
	Workaround: Remove the files, if needed.
	Keywords: Installation

Internal Ref. Number	Issue
	Discovered in Release: 5.6-1.0.3.3
3046601	Description: When rebuilding the kernel modules (add-kernel-support) for some kernel versions (specifically mainline 4.14) do not unset LDFLAGS properly. Rebuilding xpmem in such a case may fail with the error such as "unrecognized option '-Wl,-z,relro'" in the xpmem build log.
	Workaround: Either disable building xpmem by addingwithout-xpmem to the command line, or edit the kernel Makefile to make it unset LDFLAGS:
	sed -i -e '/^export ARCH/iLDFLAGS :=' /lib/modules/\$(uname -r)/Makefile
	Note: The Makefile may be located elsewhere, such as the top-level directory of the kernel source directory.
	Keywords: Installation, SLES
	Discovered in Release: 5.6-1.0.3.3
	Description: After installing OFED with rebuilt kernel modules, error messages indicating that the kernel module mlx5_ib failed to load (e.g. "mlx5_ib: Unknown symbol") appear. These messages could be safely ignored because the module eventually loads.
3048411	Workaround: Run the command 'dracut -f' to update the initramfs.
	Keywords: Installation
	Discovered in Release: 5.6-1.0.3.3
3048444	Description: OFED installation failed using yum foradd-kernel-support option (building packages without KMP enabled) if libfabric package is installed.
	Workaround: Remove libfabric package before OFED installation or use installation script.
	Keywords: Installation, RHEL 8.5
	Discovered in Release: 5.6-1.0.3.3
3015210	Description: OVS topology where the tunnel device is over a VF and the VF representor is connected to a bond is not supported.

Internal Ref. Number	Issue
	Workaround: N/A
	Keywords: ASAP ² , Tunnel Over VF, LAG, Connection Tracking
	Discovered in Release: 5.6-1.0.3.3
	Description: OVS metering is not support over kernel 5.17.
3028300	Workaround: N/A
3026300	Keywords: ASAP ² ,OVS, Meter, Kernel 5.17
	Discovered in Release: 5.6-1.0.3.3
	Description: Destroying mlxdevm group while SF is attached to it is not supported.
2044255	Workaround: N/A
3044255	Keywords: ASAP ² , mlxdevm, QoS, Group, Scalable Functions, ConnectX-6 Dx
	Discovered in Release: 5.6-1.0.3.3
2900346	Description: On Ubuntu OS, configuring different IP addresses with different subnets to both ports 0 and 1 is currently not supported. When trying to ping from port 0 on one BlueField-2 card to port 0 on the other BlueField-2 card, then both port 0 and port 1 on the receiving side send a reply to the ARP request (a.k.a, ARP flux).
	Workaround: N/A
	Keywords: BlueField-2, Ubuntu, ARP Flux
	Discovered in Release: 5.6-1.0.3.3
	Description: Switching between SwitchDev mode and legacy mode quickly on BlueField-2 can prevent the driver from loading successfully and breaks its health recovery.
3046456	Workaround: Pause 60 seconds between state-altering commands to guarantee the driver health recovery is completed successfully.
	Keywords: ASAP ² , Health Recovery
	Discovered in Release: 5.6-1.0.3.3

Internal Ref. Number	Issue
2934149	Description: Adding vDPA ports over ConnectX-5 devices in ovs-dpdk is not supported and will cause a crash.
	Workaround: N/A
	Keywords: OVS-DPDK, ConnectX-5
	Discovered in Release: 5.6-1.0.3.3
	Description: Running I/O traffic and toggling both physical ports status (UP/DOWN) in a stressful manner on the receiving-end machine may cause traffic loss.
2934833	Workaround: N/A
	Keywords: RDMA, Port Toggle
	Discovered in Release: 5.6-1.0.3.3
2901514	Description: Relaxed Ordering is not working properly on Virtual Functions.
	Workaround: N/A
	Keywords: Relaxed Ordering, VF
	Discovered in Release: 5.6-1.0.3.3

Internal Ref. Number	Issue
2870299	Description: Managing SFs is possible using the iproute2 with mlxdevm tool only.
	Workaround: N/A
	Keywords: Scalable Functions

Internal Ref. Number	Issue
	Discovered in Release: 5.5-1.0.3.2
	Description: OFED packages were built with DKMS disabled since building OFED with DKMS failed due to a problem in the DKMS package on UOSdkms flag should not be used.
2869722	Workaround: N/A
	Keywords: Installation, DKMS
	Discovered in Release: 5.5-1.0.3.2
	Description: On UOS, IPoIB PKEY may require manual bring up after driver restart.
2870367	Workaround: N/A
	Keywords: Installation, IPoIB, PKEY
	Discovered in Release: 5.5-1.0.3.2
2836032	Description: When using Software steering mlx5dv_dr API to create rules containing encapsulation actions in MLNX_OFED v5.5-1.x.x.x, upgrade firmware to the latest version. Otherwise, the maximum number of encapsulation actions that can be created will be limited to only 16K, and degradation for the rule insertion rate is expected compared to MLNX_OFED v5.4x.x.x.x.
	Workaround: N/A
	Keywords: Software Steering
	Discovered in Release: 5.5-1.0.3.2
	Description: Enabling ARFS in legacy mode and then moving to switchdev mode is not supported and may cause unwanted behavior.
2851639	Workaround: N/A
	Keywords: NetDev, ARFS
	Discovered in Release: 5.5-1.0.3.2
2851639	Description: nvme and iser are not enabled on UOS ARM, because of missing UOS kernel support.
	Workaround: N/A

Internal Ref. Number	Issue
	Keywords: nvme, iser, UOS ARM
	Discovered in Release: 5.5-1.0.3.2
2860855	Description: Building OFED on RHEL 8.4 with kmp disabled and then installing with yum fails due to some conflicting packages.
	Workaround: Remove libfabric and librpmem packages before OFED installation,or addallowerasing option to the installation command.
	Keywords: Installation, RHEL 8.4, kmp, yum
	Discovered in Release: 5.5-1.0.3.2
2865983	Description: OFED packages were built with kmp disabled. Building with kmp enabled fails due to missing packages.
	Workaround: N/A
	Keywords: Installation, kmp
	Discovered in Release: 5.5-1.0.3.2

Internal Ref. Number	Issue
2658644	Description: Only match on lower 32 bit of ct_label is supported.
	Workaround: N/A
	Keywords: ASAP ² , Connection Tracking
	Discovered in Release: 5.4-1.0.3.0
2706345	Description: Number of RQ and TIR allocation in the driver depends on total number of MSI-X vectors allocated. Total number of TIRs supported by device is 16K range. Each representor needs number of CPUs worth TIRs, upto maximum of 128.
	Workaround: To use large number of VFs, set PF_NUM_PF_MSIX to a smaller value of around 32.
	Keywords: ASAP ² ,VF, PF_NUM_PF_MSIX
	Discovered in Release: 5.4-1.0.3.0

Internal Ref. Number	Issue
2836997	Description: An automatic test that checks a flow meter rate fluctuation stays within a fixed threshold (e.g., 10%) may fail because meter precision is dependent on multiple factors (i.e., rate and burst values and shape of the traffic). To pick the best configuration parameters for a flow meter, perform a couple of test measurements using different values of burst size against expected traffic workload and average the results over an extended period of time (tens of minutes).
	Workaround: N/A
	Keywords: ASAP ² ,Meter Threshold
	Discovered in Release: 5.4-1.0.3.0
2863456	Description: SA limit by packet count (hard and soft) are supported only on traffic originated from the ECPF. Trying to configure them on VF traffic will remove the SA when hard limit is hit, however traffic could still pass as plain text due to the tunnel offload that is used in such configuration.
	Workaround: N/A
	Keywords: ASAP ² , IPsec Full Offload
	Discovered in Release: 5.4-0.5.1.1
	Description: OFED installation caused CIFS to break in RHEL 8.4 and above. A dummy module was added so that CIFS will be disabled after OFED installation in RHEL 8.4 and above.
2657392	Workaround: N/A
	Keywords: Installation, RHEL, CIFS
	Discovered in Release: 5.4-0.5.1.1
	Description: OpenMPI does not support running across different operating systems and/or CPU architectures.
2800993	Workaround: N/A
	Keywords: OpenMPI

Internal Ref. Number	Issue
2399503	Description: O pen vSwitch is not supported on the latest operating systems containing only Python3 support.
	Workaround: N/A
	Keywords: Python, O pen vSwitch
	Description: OFED installation caused CIFS to break in RHEL8.4. A dummy module was added so that CIFS will be disabled after OFED installation in RHEL8.4.
2657392	Workaround: N/A
	Keywords: Installation, RHEL8.4, CIFS
	Discovered in Release: 5.4-0.5.1.1
	Description: Running yum update will upgrade kylin-release to a higher version. The version of this package is used for kylin10sp2 detection so the script will detect kylin 10 instead of kylin10sp2 and use its repository by mistake.
2782406	Workaround: Because there are no special cases for kylin10sp2, the repository that was detected with addingadd-kernel-support to the installation command can be used.
	Keywords: Upgrade, kylin
	Discovered in Release: 5.4-3.0.3.0
	Description: On dual port cards with SR-IOV, when one port link is configured to InfiniBand and the other port link is configured to Ethernet, the Ethernet port will not be able to support VST and QinQ.
2755632	Workaround: N/A
	Keywords: SR-IOV, VST, QinQ
	Discovered in Release: 5.4-3.0.3.0
2780436	Description: Non-default MTU (>1500) is not supported with IPsec crypto offload and may cause packet drops.
	Workaround: N/A
	Keywords: IPsec, Crypto Offload, MTU

Internal Ref. Number	Issue
	Discovered in Release: 5.4-3.0.3.0
2726021	Description: Building packages on openEuler with kmp enabled requires kernel-rpm-macros package installed. kernel-rpm-macros-30-13.0e1 does not support -p option and kernel-rpm-macros-30-18.0e1 should be installed instead. On kylin OS, the version of kernel-rpm-macros package does not support -p option needed to support kmp, so it will stay disabled.
	Workaround: N/A
	Keywords: Installation, openEuler
	Discovered in Release: 5.4-3.0.3.0

Internal Ref. Number	Issue
2750653	Description: Running fragmented traffic in RHEL 8.3 (4.18.0-240.el8.x86_64) may cause call trace in build_skb.
	Workaround: Update to RHEL 8.3 z-stream 4.18.0-240.22.1.el8_3.x86_64.
	Keywords: RHEL 8.3, Kernel Panic, Call Trace, fr
	Discovered in Release: 5.4-1.0.3.0
2629375	Description: Matching on CT label is only supported when matching on lower 32 bits. Full match on all 128 bits of CT label is not supported.
	Workaround: N/A
	Keywords: ASAP ² , Connection Tracking, Label
	Discovered in Release: 5.4-1.0.3.0
2707997	Description: Installation in the package manager mode under SLES 15.x may require user-intervention if the original libibverbs is installed.

Internal Ref. Number	Issue
	Workaround: zypper installforce-resolution mlnx-ofed-all
	Keywords: Installation, libibverbs
	Discovered in Release: 5.4-1.0.3.0
	Description: Installation in the package manager mode under SLES 15.x may require user-intervention if the original libopenvswitch is installed.
2708531	Workaround: zypper installforce-resolution mlnx-ofed-all
	Keywords: Installation
	Discovered in Release: 5.4-1.0.3.0
	Description: Congested TCP lock for kTLS TX device offload traffic compromises the performance.
2703043	Workaround: Disable TCP selective acknowledgement: echo 0 > /proc/sys/net/ipv4/tcp_sack
	Keywords: kTLS TX
	Discovered in Release: 5.4-1.0.3.0
	Description: If the package interface-rename is active (on XenServer, for example), the interface renaming by the OFED will not be done to eliminate conflicts.
2676405	Workaround: N/A
	Keywords: Interface Renaming
	Discovered in Release: 5.4-1.0.3.0
	Description: Offload of rules which redirect from VF on one PF to VF on second PF is not supported on socket-direct devices.
2687943	Workaround: N/A
	Keywords: ASAP ² , Socket-Direct
	Discovered in Release: 5.4-1.0.3.0
2678672	Description: When disabling switchdev mode, the qdisc in tunnel device cannot be destroyed and mlx5e_stats_flower() is still called by OVS resulting in NULL pointer panic and memory leak.

Internal Ref. Number	Issue
	Workaround: N/A
	Keywords: SwitchDev, mlx5, Tunnel Traffic
	Discovered in Release: 5.4-1.0.3.0
2566548	Description: On PPC systems when EEH is enabled, running fw sync reset (either by mlxfwreset with flagsync 1 or by devlink dev reload action fw_activate), the EEHmay catch the PCI reset and take ownership on the flow. When run few times in sequence, the EEH may also decide to disable the device.
	Workaround: Administrator may disable EEH before running firmware sync reset on the device.
	Keywords: PPC, EEH
	Discovered in Release: 5.4-1.0.3.0
	Description: TX port timestamp feature is supported for kernel versions 3.15 and greater. On older kernel versions, the feature will not be supported and ptp_tx _* counters will not increment.
2617950	Workaround: N/A
	Keywords: Ethtool
	Discovered in Release: 5.4-1.0.3.0
2390731	Description: Ethtool does not display Port Speed advertised/capability above 100Gb/s over and below kernels 5.0, even when supported.
	Workaround: N/A
	Keywords: Ethtool, Port Speed
	Discovered in Release: 5.4-1.0.3.0

Internal Ref. Number	Issue
2687198	Description: Activating VF/SF LAG when at least one VF/SF is still bound may lead to an internal error in the firmware.

Internal Ref. Number	Issue
	Workaround: Make sure all VFs/SFs are unbound prior to VF/SF LAG activation/deactivation.
	Keywords: VF, SF, Firmware, Binding
	Discovered in Release: 5.4-1.0.3.0

Internal Ref. Number	Issue
	Description: After disabling sync reset by setting enable_remote_dev_reset to false, running firmware sync reset a few times may lead to general protection fault and system may get stuck.
2585575	Workaround: N/A
	Keywords: Firmware Upgrade
	Discovered in Release: 5.3-1.0.0.1
	Description: Conducting a firmware reset or unbinding the PF while in switchdev mode may cause a kernel crash.
2582565	Workaround: N/A
	Keywords: SwitchDev, ASAP ² , Unbind, Firmware Reset
	Discovered in Release: 5.3-1.0.0.1
	Description: PTP synchronization may be lost while using tx_port_ts private flag.
2587802	Workaround: Toggle private flag: ethtoolset-priv-flags tx_port_ts off ethtoolset-priv-flags tx_port_ts on restart ptp4l application
	Keywords: PTP Synchronization
	Discovered in Release: 5.3-1.0.0.1
2574943	Description: When running kernel 5.8 and bellow or RHEL 8.2 and below, sampled packets do not support tunnel information.
	Workaround: N/A

Internal Ref. Number	Issue
	Keywords: ASAP ² , sFLOW
	Discovered in Release: 5.3-1.0.0.1
2568417	Description: Upon upgrade to version 5.3, the package manager tool will install the new packages and then remove the old packages, a depmod WARNING on "mlx5_fpga_tools" will appear. This warning can be safely ignored. mlx5_fpga_tools is a module that existed in version 5.2 and was removed in 5.3.
	Workaround: N/A
	Keywords: Upgrade; mlx5_fpga_tools
	Discovered in Release: 5.3-1.0.0.1
2506425	Description: When installing kmod packages on EulerOS 2.0SP9 or OpenEuler 20.03, the following error appears: "modprobe: FATAL: could not get modversions of ". This error can be safely ignored. It is caused by incorrectly adding directories to a list of modules processed by /usr/sbin/weak-modules.
	Workaround: N/A
	Keywords: Installation; modules; kmod
	Discovered in Release: 5.3-1.0.0.1
2492509	Description: When installing the driver on OpenEuler or on EulerOS 2.0SP9, rebuilding the drivers (add-kernel-support) with thekmp option (to create kmod packages) generates packages that are uninstallable because they have a dependency on "/sbin/depmod" that the system does not provide. This dependency is created by a buggy kmod package building tool included with the distribution.
	Workaround: N/A
	Keywords: add-kernel-support
	Discovered in Release: 5.3-1.0.0.1
2479327	Description: On SLES 12 SP5, if the kernel was upgraded to 4.12.14-122.46, it is not possible to rebuild kernel modules (add-kernel-support) without upgrading gcc as well to at least 4.8.5-31.23.2.

Internal Ref. Number	Issue
	Workaround: N/A
	Keywords: Upgrade; SLES 12; add-kernel-support
	Discovered in Release: 5.3-1.0.0.1
	Description: On SLES 12 SP5, if the kernel was upgraded to 4.12.14-122.46, it is not possible to rebuild kernel modules (add-kernel-support) without upgrading gcc as well to at least 4.8.5-31.23.2.
2584441	Workaround: N/A
	Keywords: Upgrade; SLES 12; add-kernel-support
	Discovered in Release: 5.3-1.0.0.1
	Description: When setting MTU to low values, such as 68 bytes, packets may fail on oversize.
2460865	Workaround: N/A
	Keywords: MTU
	Discovered in Release: 5.3-1.0.0.1
	Description: On kernels based on RedHat 7.2, the "tx_port_ts" feature, as set by ethtool —set-priv-flags, is disabled.
2383318	Workaround: N/A
	Keywords: RedHat; tx_port_ts
	Discovered in Release: 5.3-1.0.0.1
	Description: An OvS-DPDK crash might occur while doing livemigration for VMs that use virtio-interfaces that are accelerated using OvS-DPDK vDPA ports.
2575647	Workaround: N/A
	Keywords: OvS-DPDK vDPA, Live-migration
	Discovered in Release: 5.3-1.0.0.1

Internal Ref. Number	Issue
	Description: After reloading devlink in IPoIB setup, the IB link may stay in initialization state and require to run OpenSM to get the IB link to active state.
2430071	Workaround: N/A
	Keywords: IPoIB devlink reload
	Discovered in Release: 5.2-2.2.0.0
	Description: On EulerOS 2.0 SP9 systems, the kernel ABI (kABI) between the base vhulk2006 kernel and the errata vhulk2008 kernel has been changed. It is now not possible to install MLNX_OFED compiled with KMP on vhulk2006 kernel on a vhulk2008 system.
2302786	Workaround: Install MLNX_OFED withadd-kernel-support.
	Keywords: EulerOS; kABI; installation;add-kernel-support
	Discovered in Release: 5.2-1.0.4.0
	Description: A crash in the TLS Rx socket cleanup flow may occur due to a kernel issue where a wrong extra call to tls_dev_del is made.
2398281	Workaround: N/A
	Keywords: TLS RX device offload
	Discovered in Release: 5.2-1.0.4.0
	Description: OpenEuler 20.03 Aarch64 with errata kernels 4.19.90-2011.6.0.0049.oe1.aarch64 and 4.19.90-2012.5.0.0054.oe1.aarch64 are incompatible with MLNX_OFED kmod-mlnx-ofa_kernel.
2407415	Workaround: Install MLNX_OFED withadd-kernel-support.
	Keywords: OpenEuler; Aarch64; installation;add-kernel-support
	Discovered in Release: 5.2-1.0.4.0
2348077	Description: RDMA device name for VFs may change after resetting all VFs at once.
	Workaround: Either reset interfaces one by one with a delay in between, or use a network interface naming scheme with predictable interface names, such as NAME_PCI or NAME_GUID. Copy

Internal Ref. Number	Issue
	/lib/udev/rules.d/60-rdma-persistent-naming.rules to /etc/udev/rules.d/ and edit the last line accordingly. Note that this will change interface names.
	Keywords: RDMA; VF
	Discovered in Release: 5.2-1.0.4.0
	Description: esp4_offload and esp6_offload modules are expected to be loaded according to the list determined by the default kernel. However, these modules cannot be loaded when working over Debian 10 with non-default custom kernel as they are not included in it.
2381713	Workaround: Either install MLNX_OFED usingadd-kernel-support, or rebuild the non-default custom kernel to include these modules.
	Keywords: esp4_offload; esp6_offload; kernel, Debian
	Discovered in Release: 5.2-1.0.4.0
	Description : On kernel 4.14, there is no traffic for UDP or TCP with payload size larger than 1398 on GENEVE IPv6 over VLAN tag interface.
2382898	Workaround: N/A
	Keywords: GENEVE; stag; VLAN; UDP
	Discovered in Release: 5.2-1.0.4.0
	Description: When toggling the link state while running RoCE traffic, the below warning may appear in the dmesg:ib_cache_gid_add: unable to add gid <gid> error=-28</gid>
2326155	Workaround: N/A
	Keywords: RoCE;ib_cache_gid_add
	Discovered in Release: 5.2-1.0.4.0
2329654	Description: Running XDP over an IP tunnel may fail when working with kernels as old as version 4.14.
	Workaround: N/A
	Keywords: XDP, Kernel
	Discovered in Release: 5.2-1.0.4.0

Internal Ref. Number	Issue
2249156	Description: MLNX_OFED installation will remove qperf package in case it was done after qperf installation.
	Workaround : Make sure to install qperf package after installing MLNX_OFED, or re-install qperf after installing MLNX_OFED.
	Keywords: Installation; qperf
	Discovered in Release: 5.2-1.0.4.0
	Description: OFED installation requires kernel config CONFIG_DEBUG_INFO to be set.
2355956	Workaround: N/A
	Keywords: Installation; CONFIG_DEBUG_INFO
	Discovered in Release: 5.2-1.0.4.0
	Description: Openibd may fail to unload the Inbox driver mlx5_ib on Ubuntu 18.04 PPC Boston server due to a bug in the Inbox drivers.
2362781	Workaround: N/A
	Keywords: Openibd; Inbox; Ubuntu; mlx5_ib
	Discovered in Release: 5.2-1.0.4.0
2367659	Description: Upgrading the MLNX_OFED version that is configured as a YUM repository may yield warning messages from depmod about unknown symbols, such as: depmod: WARNING: /lib/modules/4.18.0-240.el8.×8664/extra/iser/ib_iser.ko needs unknown symbol ib_fmr_pool_unmap depmod: WARNING: /lib/modules/4.18.0-240.el8.×8664/extra/srp/ib_srp.ko needs unknown symbol ib_create_qp_user These warnings appear since the RPM packages upgrade occurs sequentially, and there is an upgrade dependency between some of the modules, which would create a state of upgrade inconsistency. These warnings are temporary and can be ignored as eventually all modules will be upgraded, and the warnings will no longer appear.
	Workaround: N/A
	Keywords: YUM; RPM; symbol; depmod; ISER; SRP
	Discovered in Release: 5.2-1.0.4.0

Internal Ref. Number	Issue
2385269	Description: The number of connections offloaded is limited to 100K when working with Kernel v5.9.
	Workaround: N/A
	Keywords: ASAP2; Connection Tracking; Kernel
	Discovered in Release: 5.2-1.0.4.0
	Description: Mirroring is not supported with Connection Tracking when the source port is a VxLAN device.
2393169	Workaround: N/A
	Keywords: ASAP ² ; Connection Tracking; Mirroring
	Discovered in Release: 5.2-1.0.4.0
2395082	Description: A call trace may take place when moving from SwitchDev mode back to Legacy mode in Kernel v5.9 due to a kernel issue in tcf_block_unbind.
	Workaround: N/A
	Keywords: ASAP ² ;SwitchDev; call trace; kernel; tcf_block_unbind
	Discovered in Release: 5.2-1.0.4.0

Internal Ref. Number	Issue
2354899	Description: ODP is not supported on RHEL7.x systems when running over an ETH link layer with RoCE disabled.
	Workaround: N/A
	Keywords: ODP, RHEL, RoCE
	Discovered in Release: 5.1-2.5.8.0
2338150	Description: Scatter to CQE feature should be disabled for the GPUDirect tests to work.
	Workaround: Set the MLX5_SCATTER_TO_CQE environment variable to 0 before the ib_send_bw command. For example: MLX5_SCATTER_TO_CQE=0 ib_send_bw -d <>

Internal Ref. Number	Issue
	Keywords: CQE, GPUDirect
	Discovered in Release: 5.1-2.5.8.0
2295732	Description: Upgrading from legacy (mlnx-libs) to the current rdma-core based build using YUM (package manager) fails.
	Workaround: To perform this upgrade, either use the installer script or uninstall the old packages and install the new packages.
	Keywords: Legacy, mlnx-libs, rdma-core, installation
	Discovered in Release: 5.1-2.5.8.0
	Description: Upgrading from legacy (mlnx-libs) to the current rdma-core based build using the apt-get (package manager) fails.
2295735	Workaround: To perform this upgrade, either use the installer script or uninstall the old packages and install the new packages.
	Keywords: Legacy, mlnx-libs, rdma-core, apt, apt-get, installation
	Discovered in Release: 5.1-2.5.8.0
	Description: Downgrading the firmware version for ConnectX-6 cards using "mlnx_ofed_installfw-update-onlyforce-fw-update" fails.
2248996	Workaround: Manually downgrade the firmware version - please see <u>Firmware Update Instructions</u> .
	Keywords: Firmware, ConnectX-6
	Discovered in Release: 5.1-0.6.6.0
2175930	Description: When using OFED 5.1 on PPC architectures with kernels v5.5 or v5.6 and an old ethtool utility, a harmless warning call trace may appear in the dmesg due to mismatch between user space and kernel. The warning call trace mentions ethtool_notify.
	Workaround: Update the ethtool utility to version 5.6 on such systems in order to avoid the call trace.
	Keywords: PPC, ethtool_notify, kernel
	Discovered in Release: 5.1-0.6.6.0

Internal Ref. Number	Issue
2198764	Description: If MLNX_OFED is installed on a Debian or Ubuntu system that is run in chroot environment, the openibd service will not be enabled. If the chroot files are being used as a base of a full system, the openibd service is left disabled.
	Workaround: Currently, openibd is a sysv-init script that you can enable manually by running: update-rc.d openibd defaults
	Keywords: chroot, Debian , Ubuntu, openibd
	Discovered in Release: 5.1-0.6.6.0
	Description: Running connection tracking (CT) with FW steering may cause CREATE_FLOW_TABLE command to fail with syndrome.
2237134	Workaround: Configure OVS to use a single handler-thread: #ovs-vsctl set Open_vSwitch . other_config:n-handler-threads=1
	Keywords: Connection tracking, ASAP, OVS, FW steering
	Discovered in Release: 5.1-0.6.6.0
	Description: Running OpenVSwitch offload with high traffic throughput can cause low insertion rate due to high CPU usage.
2239894	Workaround: Reduce the number of combined channels of the uplink using "ethtool -L".
	Keywords: Insertion rate, ASAP2
	Discovered in Release: 5.1-0.6.6.0
	Description: Header rewrite action is not supported over RHEL/CentOS 7.4.
2240671	Workaround: N/A
2242546	Keywords: ASAP, header rewrite, RHEL, RedHat, CentOS, OS
	Discovered in Release: 5.1-0.6.6.0
	Description: Tunnel offload (encap/decap) may cause kernel panic if nf_tables module is not probed.
	Workaround: Make sure to probe the nf_tables module before inserting any rule.

Internal Ref. Number	Issue
	Keywords: Kernel v5.7, ASAP, kernel panic
	Discovered in Release: 5.1-0.6.6.0
	Description: IPsec packets are dropped during heavy traffic due to a bug in net/xfrm Linux Kernel.
2143007	Workaround: Make sure the Kernel is modified to apply the following patch: "xfrm: Fix double ESP trailer insertion in IPsec crypto offload".
	Keywords: IPsec, xfrm
	Discovered in Release: 5.1-0.6.6.0
	Description: VF mirroring with TC policy skip_sw is not supported on RHEL/CentOS 7.4, 7.5 and 7.6 OSs.
2225952	Workaround: N/A
	Keywords: ASAP ² , Mirroring, RHEL, RedHat, OS
	Discovered in Release: 5.1-0.6.6.0
2216521	Description: After upgrading MLNX_OFED from v5.0 or earlier, ibdev2netdev utility changes the installation prefix to /usr/sbin. Therefore, it cannot be found while found in the same SHELL environment.
	Workaround: After installing MLNX_OFED, log out and log in again to refresh the SHELL environment.
	Keywords: ibdev2netdev
	Discovered in Release: 5.1-0.6.6.0
	Description: Rules with VLAN push/pop, encap/decap and header rewrite actions together are not supported.
2202520	Workaround: N/A
	Keywords: ASAP ² , SwitchDev, VLAN push/pop, encap/decap, header rewrite
	Discovered in Release: 5.1-0.6.6.0
2210752	Description: Switching from Legacy mode to SwitchDev mode and vice-

Internal Ref. Number	Issue
	versa while TC rules exist on the NIC will result in failure.
	Workaround: Before attempting to switch mode, make sure to delete all TC rules on the NIC or stop OpenvSwitch.
	Keywords: ASAP ² , Devlink, Legacy SR-IOV
	Discovered in Release: 5.1-0.6.6.0

Internal Ref. Number	Issue
2125036/21 25031	Description: Upgrading the MLNX_OFED from an UPSTREAM_LIBS based version to an MLNX_LIBS based version fails unless the driver is uninstalled and then re-installed.
	Workaround: Make sure to uninstall and re-install MLNX_OFED to complete the upgrade.
	Keywords: Installation, UPSTREAM_LIBS, MLNX_LIBS
	Discovered in Release: 5.0-2.1.8.0
	Description: hns_roce warning messages will appear in the dmesg after reboot on Euler2 SP3 OSs.
2105447	Workaround: N/A
	Keywords: hns_roce, dmesg, Euler
	Discovered in Release: 5.0-2.1.8.0
	Description: Multiple driver restarts may cause IPoIB soft lockup.
2110321	Workaround: N/A
	Keywords: Driver restart, IPoIB
	Discovered in Release: 5.0-2.1.8.0
2112251	Description: On kernels 4.10-4.14, when Geneve tunnel's remote endpoint is defined using IPv6, packets larger than MTU are not

Internal Ref. Number	Issue
	fragmented, resulting in no traffic sent.
	Workaround: Define geneve tunnel's remote endpoint using IPv4.
	Keywords: Kernel, Geneve, IPv4, IPv6, MTU, fragmentation
	Discovered in Release: 5.0-2.1.8.0
	Description: A kernel panic may occur over RH8.0-4.18.0-80.el8.x86_64 OS when opening kTLS offload connection due to a bug in kernel TLS stack.
2102902	Workaround: N/A
	Keywords: TLS offload, mlx5e
	Discovered in Release: 5.0-2.1.8.0
	Description: A Kernel panic may occur over Ubuntu19.04-5.0.0-38-generic OS when opening kTLS offload connection due to a bug in the Kernel TLS stack.
2111534	Workaround: N/A
	Keywords: TLS offload, mlx5e
	Discovered in Release: 5.0-2.1.8.0
	Description: An internal error might take place in the firmware when performing any of the following in VF LAG mode, when at least one VF of either PF is still bound/attached to a VM.
	1. Removing PF from the bond (using ifdown, ip link or any other function)
2035950	2. Attempting to disable SR-IOV
	Workaround: N/A
	Keywords: VF LAG, binding, firmware, FW, PF, SR-IOV
	Discovered in Release: 5.0-1.0.0.0
2044544	Description: When working with OSs with Kernel v4.10, bonding module does not allow setting MTUs larger than 1500 on a bonding interface.
	Workaround: Upgrade your Kernel version to v4.11 or above.

Internal Ref. Number	Issue
	Keywords: Bonding, MTU, Kernel
	Discovered in Release: 5.0-1.0.0.0
	Description: Libibverbs dependencies are removed during OFED installation, requiring manual installation of libraries that OFED does not reinstall.
1882932	Workaround: Manually install missing packages.
	Keywords: libibverbs, installation
	Discovered in Release: 5.0-1.0.0.0
	Description: ibdev2netdev command returns duplicate devices with different ports in SwitchDev mode.
2058535	Workaround: Use /opt/mellanox/iproute2/sbin/rdma link show command instead.
	Keywords: ibdev2netdev
	Discovered in Release: 5.0-1.0.0.0
	Description: In RHEL/CentOS 7.2 OSs, adding drop rules when act_gact is not loaded may cause a kernel crash.
2072568	Workaround: Preload all needed modules to avoid such a scenario (cls_flower, act_mirred, act_gact, act_tunnel_key and act_vlan).
	Keywords: RHEL/CentOS 7.2, Kernel 4.9, call trace, ASAP
	Discovered in Release: 5.0-1.0.0.0
	Description: VF LAG configuration is not supported when the NUM_OF_VFS configured in mlxconfig is higher than 64.
2093698	Workaround: N/A
	Keywords: VF LAG, SwitchDev mode, ASAP
	Discovered in Release: 5.0-1.0.0.0
2093746	Description: Devlink health dumps are not supported on kernels lower than v5.3.
	Workaround: N/A

Internal Ref. Number	Issue
	Keywords: Devlink, health report, dump
	Discovered in Release: 5.0-1.0.0.0
	Description: Sending packets larger than MTU is not supported when working with OVS-DPDK.
2000590	Workaround: N/A
	Keywords: MTU, OVS-DPDK
	Discovered in Release: 5.0-1.0.0.0
	Description: Moving VF from SwitchDev mode to Legacy mode while the representor is being used by OVS-DPDK results in a segmentation fault.
2062900	Workaround: To move VF to Legacy mode with no error, make sure to delete the ports from the OVS.
	Keywords: SwitchDev, Legacy, representor, OVS-DPDK
	Discovered in Release: 5.0-1.0.0.0
	Description: Huge pages configuration is lost each time the server is configured.
2075942	Workaround: Re-configure the huge pages after each reboot, or configure them as a kernel parameter.
	Keywords: Huge pages, reboot, OVS-DPDK
	Discovered in Release: 5.0-1.0.0.0
	Description: MLNX_OFED cannot be installed on Debian 9.11 OS in SwitchDev mode.
2067012	Workaround: Install OFED with the flagadd-kernel-support.
	Keywords: ASAP, SwitchDev, Debian, Kernel
	Discovered in Release: 5.0-1.0.0.0
2036572	Description: When using a thread domain and the lockless rdma-core ibv_post_send path, there is an additional CPU penalty due to required barriers around the device MMIO buffer that were omitted in MLNX_OFED.

Internal Ref. Number	Issue
	Workaround: N/A
	Keywords: rdma-core, write-combining, MMIO buffer
	Discovered in Release: 5.0-1.0.0.0

Internal Ref. Number	Issue
	Description: The argparse module is installed by default in Python versions =>2.7 and >=3.2. In case an older Python version is used, the argparse module is not installed by default.
-	Workaround: Install the argparse module manually.
	Keywords: Python, MFT, argparse, installation
	Discovered in Release: 4.7-3.2.9.0
1997230	Description: Running mlxfwreset or unloading mlx5_core module while contrak flows are offloaded may cause a call trace in the kernel.
	Workaround: Stop OVS service before calling mlxfwreset or unloading mlx5_core module.
	Keywords: Contrak, ASAP, OVS, mlxfwrest, unload
	Discovered in Release: 4.7-3.2.9.0
1955352	Description : Moving 2 ports to SwitchDev mode in parallel is not supported.
	Workaround: N/A
	Keywords: ASAP, SwitchDev
	Discovered in Release: 4.7-3.2.9.0
1979958	Description: VxLAN IPv6 offload is not supported over CentOS/RHEL v7.2 OSs.

Internal Ref. Number	Issue
	Workaround: N/A
	Keywords: Tunnel, VXLAN, ASAP, IPv6
	Discovered in Release: 4.7-3.2.9.0
	Description: PRIO_TAG_REQUIRED_EN configuration is not supported and may cause call trace.
1991710	Workaround: N/A
	Keywords: ASAP, PRIO_TAG, mstconfig
	Discovered in Release: 4.7-3.2.9.0
	Description: Enabling ECMP offload requires the VFs to be unbound and VMs to be shut down.
1967866	Workaround: N/A
	Keywords: ECMP, Multipath, ASAP ²
	Discovered in Release: 4.7-3.2.9.0
	Description: On Ubuntu, Debian and RedHat 8 and above OSS, parsing the mfa2 file using the mstarchive might result in a segmentation fault.
1021001	Workaround: Use mlxarchive to parse the mfa2 file instead.
1921981	Keywords: MFT, mfa2, mstarchive, mlxarchive, Ubuntu, Debian, RedHat, operating system
	Discovered in Release: 4.7-1.0.0.1
	Description: MLNX_OFED does not support XDP features on RedHat 7 OS, despite the declared support by RedHat.
1840288	Workaround: N/A
	Keywords: XDP, RedHat
	Discovered in Release: 4.7-1.0.0.1
1821235	Description: When using mlx5dv_dr API for flow creation, for flows which execute the "encapsulation" action or "push vlan" action, metadata C registers will be reset to zero.
	Workaround: Use the both actions at the end of the flow process.

Internal Ref. Number	Issue
	Keywords: Flow steering
	Discovered in Release: 4.7-1.0.0.1

Internal Ref. Number	Issue	
1504785	Description: A lost interrupt issue in pass-through virtual machines may prevent the driver from loading, followed by printing managed pages errors to the dmesg.	
	Workaround: Restart the driver.	
	Keywords: VM, virtual machine	
	Discovered in Release: 4.6-1.0.1.1	
	Description: Unbinding PFs on LAG devices results in a "Failed to modify QP to RESET" error message.	
1764415	Workaround: N/A	
	Keywords: RoCE LAG, unbind, PF, RDMA	
	Discovered in Release: 4.6-1.0.1.1	
1806565	Description: RoCE default GIDs v1 and v2 are derived from the MAC address of the corresponding netdevice's PCI function, and they resemble the IPv6 address. However, in systems where the IPv6 link local address generated does not depend on the MAC address, RoCEv2 default GID should not be used.	
	Workaround: Use RoCEv2 default GID.	
	Keywords: RoCE	
	Discovered in Release: 4.6-1.0.1.1	
-	Description: Aging is not functional on bond device in RHEL 7.6.	
	Workaround: N/A	
	Keywords: VF LAG, ASAP ²	
	Discovered in Release: 4.6-1.0.1.1	

Internal Ref. Number	Issue
1747774	Description: In VF LAG mode, outgoing traffic in load balanced mode is according to the origin ring, thus, half of the rings will be coupled with port 1 and half with port 2. All the traffic on the same ring will be sent from the same port.
	Workaround: N/A
	Keywords: VF LAG, ASAP ²
	Discovered in Release: 4.6-1.0.1.1
	Description: A bonding bug found in Kernels 4.12 and 4.13 may cause a slave to become permanently stuck in BOND_LINK_FAIL state. As a result, the following message may appear in dmesg: bond: link status down for interface eth1, disabling it in 100 ms
1753629	Workaround: N/A
	Keywords: Bonding, slave
	Discovered in Release: 4.6-1.0.1.1
1712068	Description: Uninstalling MLNX_OFED automatically results in the uninstallation of several libraries that are included in the MLNX_OFED package, such as InfiniBand-related libraries.
	Workaround: If these libraries are required, reinstall them using the local package manager (yum/dnf).
	Keywords: MLNX_OFED libraries
	Discovered in Release: 4.6-1.0.1.1
-	Description: Due to changes in libraries, MFT v4.11.0 and below are not forward compatible with MLNX_OFED v4.6-1.0.0.0 and above. Therefore, with MLNX_OFED v4.6-1.0.0.0 and above, it is recommended to use MFT v4.12.0 and above.
	Workaround: N/A
	Keywords: MFT compatible
	Discovered in Release: 4.6-1.0.1.1
1730840	Description: On ConnectX-4 HCAs, GID index for RoCE v2 is inconsistent when toggling between enabled and disabled interface modes.

Internal Ref. Number	Issue	
	Workaround: N/A	
	Keywords: RoCE v2, GID	
	Discovered in Release: 4.6-1.0.1.1	
	Description : On kernels 4.10-4.14, MTUs larger than 1500 cannot be set for a GRE interface with any driver (IPv4 or IPv6).	
1717428	Workaround : Upgrade your kernel to any version higher than v4.14.	
	Keywords: Fedora 27, gretap, ip_gre, ip_tunnel, ip6_gre, ip6_tunnel	
	Discovered in Release: 4.6-1.0.1.1	
	Description : Driver reload takes several minutes when a large number of VFs exists.	
1748343	Workaround: N/A	
	Keywords: VF, SR-IOV	
	Discovered in Release: 4.6-1.0.1.1	
	Description : Running heavy traffic (such as 'ping flood') while bringing up and down other mlx5 interfaces may result in "INFO: rcu_preempt dectected stalls on CPUS/tasks:" call traces.	
1733974	Workaround: N/A	
	Keywords: mlx5	
	Discovered in Release: 4.6-1.0.1.1	
-	Description : On ConnectX-6 HCAs and above, an attempt to configure advertisement (any bitmap) will result in advertising the whole capabilities.	
	Workaround: N/A	
	Keywords: 200Gb/s, advertisement, Ethtool	
	Discovered in Release: 4.6-1.0.1.1	

Internal Ref. Number	Issue	
1699289	Description: HW LRO feature is disabled OOB, which results in increased CPU utilization on the Receive side. On ConnectX-5 adapter cards and above, this causes a bandwidth drop for a few streams.	
	Workaround: Make sure to enable HW LRO in the driver: ethtool -k <intf> lro ethtoolset-priv-flag <intf> hw_lro on</intf></intf>	
	Keywords : HW LRO, ConnectX-5 and above	
	Discovered in Release: 4.5-1.0.1.0	
1403313	Description : Attempting to allocate an excessive number of VFs per PF in operating systems with kernel versions below v4.15 might fail due to a known issue in the Kernel.	
	Workaround : Make sure to update the Kernel version to v4.15 or above.	
	Keywords : VF, PF, IOMMU, Kernel, OS	
	Discovered in Release: 4.5-1.0.1.0	
	Description : NEO-Host is not supported on the following OSs:	
	• SLES12 SP3	
	• SLES12 SP4	
	• SLES15	
	Fedora 28RHEL7.1	
	• RHEL7.4 ALT (Pegas1.0)	
-	• REL 7.5	
	• RHEL7.6	
	XenServer 4.9	
	Workaround: N/A	
	Keywords : NEO-Host, operating systems	
	Discovered in Release: 4.5-1.0.1.0	
1521877	Description : On SLES 12 SP1 OSs, a kernel tracepoint issue may cause undefined behavior when inserting a kernel module with a wrong parameter.	

Internal Ref. Number	Issue	
	Workaround: N/A	
	Keywords : mlx5 driver, SLES 12 SP1	
	Discovered in Release: 4.5-1.0.1.0	

User Manual

- Introduction
- <u>Installation</u>
- Features Overview and Configuration
- Programming
- InfiniBand Fabric Utilities
- Troubleshooting
- Common Abbreviations and Related Documents

Introduction

This manual is intended for system administrators responsible for the installation, configuration, management and maintenance of the software and hardware of VPI (InfiniBand, Ethernet) adapter cards. It is also intended for application developers.

NVIDIA OFED is a single Virtual Protocol Interconnect (VPI) software stack which operates across all NVIDIA network adapter solutions supporting the following uplinks to servers:

Uplink/Adapter Card	Driver Name	Uplink Speed
BlueField-2	mlx5	 InfiniBand: SDR, FDR, EDR, HDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE², 100GbE²
BlueField		 InfiniBand: SDR, QDR, FDR, FDR10, EDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE, 100GbE

Uplink/Adapter Card	Driver Name	Uplink Speed
ConnectX-7		 InfiniBand: EDR, HDR100, HDR, NDR200, NDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE², 100GbE², 200GbE³
ConnectX-6 Lx		• Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE ²
ConnectX-6 Dx		• Ethernet: 10GbE, 25GbE, 40GbE, 50GbE ² , 100GbE ² , 200GbE ²
ConnectX-6		 InfiniBand: SDR, FDR, EDR, HDR Ethernet: 10GbE, 25GbE, 40GbE, 50GbE², 100GbE², 200GbE²
ConnectX- 5/ConnectX-5 Ex		 InfiniBand: SDR, QDR, FDR, FDR10, EDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE, 100GbE
ConnectX-4 Lx		• Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE
ConnectX-4		 InfiniBand: SDR, QDR, FDR, FDR10, EDR Ethernet: 1GbE, 10GbE, 25GbE, 40GbE, 50GbE, 56GbE¹, 100GbE

- 1. 56GbE is an NVIDIA proprietary link speed and can be achieved while connecting an NVIDIA adapter card to NVIDIA SX10XX switch series or when connecting an NVIDIA adapter card to another NVIDIA adapter card.
- 2. Speed that supports both NRZ and PAM4 modes in Force mode and Auto-Negotiation mode.
- 3. Speed that supports PAM4 mode only.


All NVIDIA network adapter cards are compatible with OpenFabrics-based RDMA protocols and software and are supported by major operating system distributions.

NVIDIA OFED is certified with the following products:

- NVIDIA Messaging Accelerator (VMA™) software: Socket acceleration library that
 performs OS bypass for standard socket-based applications.
 Please note, VMA support is provided separately from NVIDIA OFED support. For
 further information, please refer to the VMA documentation
 (docs.nvidia.com/networking/category/vma).
- NVIDIA Unified Fabric Manager (UFM®) software: Powerful platform for managing demanding scale-out computing fabric environments, built on top of the OpenSM industry standard routing engine.
- Fabric Collective Accelerator (FCA)—FCA is a NVIDIA MPI-integrated software package that utilizes CORE-Direct technology for implementing the MPI collectives communications.

Stack Architecture

The figure below shows a diagram of the NVIDIA OFED stack, and how upper layer protocols (ULPs) interface with the hardware and with the kernel and userspace. The application level also shows the versatility of markets that NVIDIA OFED applies to.

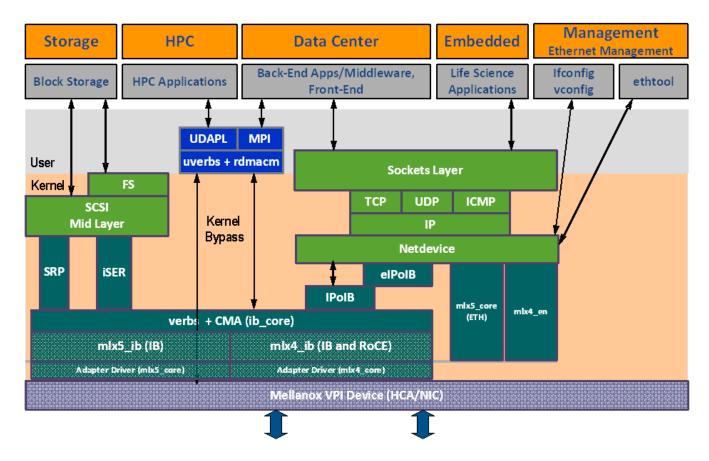

The following subsections briefly describe the various components of the NVIDIA OFED stack.

mlx4 VPI Driver



Note

This driver is no longer supported in MLNX_OFED. To work with ConnectX-3® and ConnectX-3 Pro NICs, please refer to MLNX_OFED LTS version available on the web.

mlx5 Driver

mlx5 is the low-level driver implementation for the Connect-IB® and ConnectX-4 and above adapters designed by NVIDIA. ConnectX-4 and above adapter cards operate as a VPI adapter (Infiniband and Ethernet). The mlx5 driver is comprised of the following kernel modules:

(i) Note

Please note that Connect-IB card is no longer supported in MLNX_OFED. To work with this card, please refer to MLNX_OFED LTS

mlx5_core

Acts as a library of common functions (e.g. initializing the device after reset) required by ConnectX-4 and above adapter cards. mlx5_core driver also implements the Ethernet interfaces for ConnectX-4 and above. mlx5 drivers do not require the mlx5_en module as the Ethernet functionalities are built-in in the mlx5_core module.

mlx5_ib

Handles InfiniBand-specific functions and plugs into the InfiniBand mid layer.

libmlx5

libmlx5 is the provider library that implements hardware specific user-space functionality. If there is no compatibility between the firmware and the driver, the driver will not load and a message will be printed in the dmesg.

The following are the libmlx5 **Legacy** and **RDMA-Core** environment variables:

• MLX5_FREEZE_ON_ERROR_CQE

version available on the web.

- Causes the process to hang in a loop of completion with error, which is not flushed with error or retry exceeded occurs/
- Otherwise disabled
- MLX5_POST_SEND_PREFER_BF
 - Configures every work request that can use blue flame will use blue flame
- Otherwise, blue flame depends on the size of the message and inline indication in the packet

- MLX5_SHUT_UP_BF
 - Disables blue flame feature
 - o Otherwise, do not disable
- MLX5_SINGLE_THREADED
 - All spinlocks are disabled
 - Otherwise, spinlocks enabled
 - Used by applications that are single threaded and would like to save the overhead of taking spinlocks.
- MLX5_CQE_SIZE
 - o 64—completion queue entry size is 64 bytes (default)
 - 128—completion queue entry size is 128 bytes
- MLX5_SCATTER_TO_CQE
 - Small buffers are scattered to the completion queue entry and manipulated by the driver. Valid for RC transport.
 - Default is 1, otherwise disabled

The following are libmlx5 **Legacy** only environment variables:

- MLX5_ENABLE_CQE_COMPRESSION
 - Saves PCIe bandwidth by compressing a few CQEs into a smaller amount of bytes on PCIe. Setting this variable enables CQE compression.
 - Default value 0 (disabled)
- MLX5_RELAXED_PACKET_ORDERING_ON
 See "Out-of-Order (OOO) Data Placement" section.

Mid-layer Core

Core services include management interface (MAD), connection manager (CM) interface, and Subnet Administrator (SA) interface. The stack includes components for both usermode and kernel applications. The core services run in the kernel and expose an interface to user-mode for verbs, CM and management.

Upper Layer Protocols (ULPs)

IP over IB (IPoIB)

The IP over IB (IPoIB) driver is a network interface implementation over InfiniBand. IPoIB encapsulates IP datagrams over an InfiniBand connected or datagram transport service. IPoIB pre-appends the IP datagrams with an encapsulation header and sends the outcome over the InfiniBand transport service. The transport service is Unreliable Datagram (UD) by default, but it may also be configured to be Reliable Connected (RC), in case RC is supported. The interface supports unicast, multicast and broadcast. For details, see "IP over InfiniBand (IPoIB)" section.

iSCSI Extensions for RDMA (iSER)

iSCSI Extensions for RDMA (iSER) extends the iSCSI protocol to RDMA. It permits data to be transferred directly into and out of SCSI buffers without intermediate data copies. For further information, please refer to "iSCSI Extensions for RDMA (iSER)" section.

SCSI RDMA Protocol (SRP)

SCSI RDMA Protocol (SRP) is designed to take full advantage of the protocol offload and RDMA features provided by the InfiniBand architecture. SRP allows a large body of SCSI software to be readily used on InfiniBand architecture. The SRP driver—known as the SRP Initiator—differs from traditional low-level SCSI drivers in Linux. The SRP Initiator does not control a local HBA; instead, it controls a connection to an I/O controller—known as the SRP Target—to provide access to remote storage devices across an InfiniBand fabric. The SRP Target resides in an I/O unit and provides storage services. See "SRP—SCSI RDMA Protocol" section.

User Direct Access Programming Library (uDAPL)

User Direct Access Programming Library (uDAPL) is a standard API that promotes data center application data messaging performance, scalability, and reliability over RDMA interconnects InfiniBand and RoCE. The uDAPL interface is defined by the DAT collaborative. This release of the uDAPL reference implementation package for both DAT 1.2 and 2.0 specification is timed to coincide with OFED release of the Open Fabrics (openfabrics.org) software stack.

MPI

Message Passing Interface (MPI) is a library specification that enables the development of parallel software libraries to utilize parallel computers, clusters, and heterogeneous networks. NVIDIA OFED includes the following MPI implementation over InfiniBand:

Open MPI – an open source MPI-2 implementation by the Open MPI Project

NVIDIA OFED also includes MPI benchmark tests such as OSU BW/LAT, Intel MPI BeBenchmarkand Presta.

InfiniBand Subnet Manager

All InfiniBand-compliant ULPs require a proper operation of a Subnet Manager (SM) running on the InfiniBand fabric, at all times. An SM can run on any node or on an IB switch. OpenSM is an InfiniBand-compliant Subnet Manager, and it is installed as part of NVIDIA OFED¹.

1. OpenSM is disabled by default. See "NVIDIA SM" section for details on enabling it.

Diagnostic Utilities

NVIDIA OFED includes the following two diagnostic packages for use by network and data center managers:

- ibutils—NVIDIA diagnostic utilities
- infiniband-diags—OpenFabrics Alliance InfiniBand diagnostic tools

NVIDIA Firmware Tools (MFT)

The NVIDIA Firmware Tools package is a set of firmware management tools for a single InfiniBand node. MFT can be used for:

- Generating a standard or customized NVIDIA firmware image
- Burning a firmware image to a single InfiniBand node

MFT includes a set of tools used for performing firmware update and configuration, as well as debug and diagnostics, and provides MST service. For the full list of available tools within MFT, please refer to MFT documentation (docs.nvidia.com/networking/category/mft).

Package Contents

ISO Image

NVIDIA OFED for Linux (MLNX_OFED_LINUX) is provided as ISO images or as a tarball, one per supported Linux distribution and CPU architecture, that includes *source code* and *binary* RPMs, firmware, utilities, and documentation. The ISO image contains an installation script (called mlnxofedinstall) that performs the necessary steps to accomplish the following:

- Discover the currently installed kernel
- Uninstall any InfiniBand stacks that are part of the standard operating system distribution or another vendor's commercial stack
- Install the MLNX_OFED_LINUX binary RPMs (if they are available for the current kernel)
- Identify the currently installed InfiniBand HCAs and perform the required firmware updates

Software Components

MLNX_OFED_LINUX contains the following software components:

- NVIDIA Host Channel Adapter Drivers
 - o mlx5
 - mlx5_ib
 - mlx5_core (includes Ethernet)
- Mid-layer core
 - Verbs, MADs, SA, CM, CMA, uVerbs, uMADs
- Upper Layer Protocols (ULPs)

- o IPoIB, SRP Initiator and SRP
- MPI
 - o Open MPI stack supporting the InfiniBand, RoCE and Ethernet interfaces
 - MPI benchmark tests (OSU BW/LAT, Intel MPI Benchmark, Presta)
- OpenSM: InfiniBand Subnet Manager
- Utilities
 - Diagnostic tools
 - Performance tests
 - Sysinfo (see <u>Sysinfo User Manual</u>)
- Firmware tools (MFT)
- Source code for all the OFED software modules (for use under the conditions mentioned in the modules' LICENSE files)
- Documentation

Firmware

The ISO image includes the following firmware item:

• mlnx-fw-updater RPM/DEB package, which contains firmware binaries for supported devices (using mlxfwmanager tool).

Directory Structure

The ISO image of MLNX_OFED_LINUX contains the following files and directories:

• mlnxofedinstall—the MLNX_OFED_LINUX installation script.

- ofed_uninstall.sh—This is the MLNX_OFED_LINUX un-installation script.
- <RPMS folders>—Directory of binary RPMs for a specific CPU architecture.
- src/—Directory of the OFED source tarball.

(i) Note

MLNX_OFED includes the OFED source RPM packages used as a build platform for kernel code but does not include the sources of NVIDIA proprietary packages.

- mlnx_add_kernel_support.sh—Script required to rebuild MLNX_OFED_LINUX for customized kernel version on supported Linux Distribution
- RPM based—A script required to rebuild MLNX_OFED_LINUX for customized kernel version on supported RPM-based Linux Distribution
- docs/—Directory of NVIDIA OFED related documentation

Module Parameters

mlx5_core Module Parameters

The mlx5_core module supports a single parameter used to select the profile which defines the number of resources supported.

prof_sel	The parameter name for selecting the profile. The supported values for profiles are:
	 0—for medium resources, medium performance 1—for low resources

	2—for high performance (int) (default)
guids	charp
node_guid	guids configuration. This module parameter will be obsolete!
debug_mask	debug_mask: 1 = dump cmd data, 2 = dump cmd exec time, 3 = both. Default=0 (uint)
probe_vf	probe VFs or not, 0 = not probe, 1 = probe. Default = 1 (bool)
num_of_grou ps	Controls the number of large groups in the FDB flow table. Default=4; Range=1-1024

ib_core Parameters

send_queue_size	Size of send queue in number of work requests (int)
recv_queue_size	Size of receive queue in number of work requests (int)
force_mr	Force usage of MRs for RDMA READ/WRITE operations (bool)
roce_v1_noncompat_gi	Default GID auto configuration (Default: yes) (bool)

ib_ipoib Parameters

max_nonsrq_c onn_qp	Max number of connected-mode QPs per interface (applied only if shared receive queue is not available) (int)
mcast_debug_l evel	Enable multicast debug tracing if > 0 (int)
send_queue_si ze	Number of descriptors in send queue (int)
recv_queue_si ze	Number of descriptors in receive queue (int)
debug_level Enable debug tracing if > 0 (int)	
ipoib_enhance d	Enable IPoIB enhanced for capable devices (default = 1) (0-1) (int)

Device Capabilities

Normally, an application needs to query the device capabilities before attempting to create a resource. It is essential for the application to be able to operate over different devices with different capabilities.

Specifically, when creating a QP, the user needs to specify the maximum number of outstanding work requests that the QP supports. This value should not exceed the queried capabilities. However, even when you specify a number that does not exceed the queried capability, the verbs can still fail since some other factors such as the number of scatter/gather entries requested, or the size of the inline data required, affect the maximum possible work requests. Hence an application should try to decrease this size (halving is a good new value) and retry until it succeeds.

Installation

This chapter describes how to install and test the NVIDIA OFED for Linux package on a single host machine with NVIDIA InfiniBand and/or Ethernet adapter hardware installed.

The chapter contains the following sections:

- Hardware and Software Requirements
- Downloading the Drivers
- Installing MLNX_OFED
- Uninstall
- <u>Updating Firmware After Installation</u>
- <u>UEFI Secure Boot</u>
- Performance Tuning

Features Overview and Configuration

(i) Note

It is recommended to enable the "above 4G decoding" BIOS setting for features that require a large amount of PCIe resources (e.g., SR-IOV with numerous VFs, PCIe Emulated Switch, Large BAR Requests).

The chapter contains the following sections:

- Ethernet Network
- InfiniBand Network
- <u>Storage Protocols</u>
- Virtualization
- Resiliency
- Docker Containers
- HPC-X
- Fast Driver Unload
- OVS Offload Using ASAP² Direct

Programming

(i) Note

This chapter is aimed for application developers and expert users that wish to develop applications over MLNX_OFED.

Raw Ethernet Programming

Raw Ethernet programming enables writing an application that bypasses the kernel stack. To achieve this, packet headers and offload options need to be provided by the application.

For a basic example on how to use Raw Ethernet programming, refer to the Raw Ethernet <u>Programming: Basic Introduction—Code Example Community post.</u>

Packet Pacing

Packet pacing is a raw Ethernet sender feature that enables controlling the rate of each QP, per send queue.

For a basic example on how to use packet pacing per flow over libibverbs, refer to Raw Ethernet Programming: Packet Pacing—Code Example Community post.

TCP Segmentation Offload (TSO)

TCP Segmentation Offload (TSO) enables the adapter cards to accept a large amount of data with a size greater than the MTU size. The TSO engine splits the data into separate packets and inserts the user-specified L2/L3/L4 headers automatically per packet. With the usage of TSO, CPU is offloaded from dealing with a large throughput of data. To be able to program that on the sender side, refer to the Raw Ethernet Programming: <u>TSO—Code Example</u> Community post.

ToS Based Steering

ToS/DSCP is an 8-bit field in the IP packet that enables different service levels to be assigned to network traffic. This is achieved by marking each packet in the network with a DSCP code and appropriating the corresponding level of service to it. To be able to steer packets according to the ToS field on the receiver side, refer to the Raw Ethernet Programming: ToS—Code Example Community post.

Flow ID Based Steering

Flow ID based steering enables developing a code that will steer packets using flow ID when developing Raw Ethernet over verbs. For more information on flow ID based steering, refer to the <u>Raw Ethernet Programming: Flow ID Steering—Code Example</u> Community post.

VXLAN Based Steering

VXLAN based steering enables developing a code that will steer packets using the VXLAN tunnel ID when developing Raw Ethernet over verbs. For more information on VXLAN based steering, refer to the <u>Raw Ethernet Programming: VXLAN Steering—Code Example</u> Community post.

Device Memory Programming



Note

This feature is supported on ConnectX-5/ConnectX-5 Ex adapter cards and above only.

Device Memory is an API that allows using on-chip memory located on the device as a data buffer for send/receive and RDMA operations. The device memory can be mapped and accessed directly by user and kernel applications, and can be allocated in various

sizes, registered as memory regions with local and remote access keys for performing the send/receive and RDMA operations.

Using the device memory to store packets for transmission can significantly reduce transmission latency compared to the host memory.

Device Memory Programming Model

The new API introduces a similar procedure to the host memory for sending packets from the buffer:

- ibv_alloc_dm()/ibv_free_dm() to allocate/free device memory
- ibv_reg_dm_mr to register the allocated device memory buffer as a memory region and get a memory key for local/remote access by the device
- ibv_memcpy_to_dm to copy data to a device memory buffer
- ibv_memcpy_from_dm to copy data from a device memory buffer
- ibv_post_send/ibv_post_receive to request the device to perform a send/receive operation using the memory key

For examples, see **Device Memory**.

RDMA-CM QP Timeout Control

RDMA-CM QP Timeout Control feature enables users to control the QP timeout for QPs created with RDMA-CM.

A new option in 'rdma_set_option' function has been added to enable overriding calculated QP timeout, in order to provide QP attributes for QP modification. To achieve that, rdma_set_option() should be called with the new flag RDMA_OPTION_ID_ACK_TIMEOUT. Example:

rdma_set_option(cma_id, RDMA_OPTION_ID, RDMA_OPTION_ID_ACK_TIMEOUT, &timeout, sizeof(timeout));

RDMA-CM Application Managed QP

Applications which do not create a QP through rdma_create_qp() may want to postpone the ESTABLISHED event on the passive side, to let the active side complete an application-specific connection establishment phase. For example, modifying the init state of the QP created by the application to RTR state, or make some preparations for receiving messages from the passive side. The feature returns a new event on the active side: CONNECT_RESPONSE, instead of ESTABLISHED, if id->qp==NULL. This gives the application a chance to perform the extra connection setup. Afterwards, the new rdma_establish() API should be called to complete the connection and generate an ESTABLISHED event on the passive side.

In addition, this feature exposes the 'rdma_init_qp_attr' function in librdmacm API, which enables applications to get the parameters for creating Address Handler (AH) or control QP attributes after its creation.

InfiniBand Fabric Utilities

This section first describes common configuration, interface, and addressing for all the tools in the package.

Common Configuration, Interface and Addressing Topology File (Optional)

An InfiniBand fabric is composed of switches and channel adapter (HCA/TCA) devices. To identify devices in a fabric (or even in one switch system), each device is given a GUID (a MAC equivalent). Since a GUID is a non-user-friendly string of characters, it is better to alias it to a meaningful, user-given name. For this objective, the IB Diagnostic Tools can be provided with a "topology file", which is an optional configuration file specifying the IB fabric topology in user-given names.

For diagnostic tools to fully support the topology file, the user may need to provide the local system name (if the local hostname is not used in the topology file).

To specify a topology file to a diagnostic tool use one of the following two options:

- On the command line, specify the file name using the option '-t <topology file name>'
- 2. Define the environment variable IBDIAG_TOPO_FILE

To specify the local system name to an diagnostic tool use one of the following two options:

- 1. On the command line, specify the system name using the option '-s <local system name>'
- 2. Define the environment variable IBDIAG_SYS_NAME

InfiniBand Interface Definition

 
The diagnostic tools installed on a machine connect to the IB fabric by means of an HCA port through which they send MADs. To specify this port to an IB diagnostic tool use one of the following options:

- 1. On the command line, specify the port number using the option '-p <local port number>' (see below)
- 2. Define the environment variable IBDIAG_PORT_NUM

In case more than one HCA device is installed on the local machine, it is necessary to specify the device's index to the tool as well. For this use on of the following options:

- 1. On the command line, specify the index of the local device using the following option: '-i <index of local device>'
- 2. Define the environment variable IBDIAG_DEV_IDX

Addressing



This section applies to the ibdiagpath tool only. A tool command may require defining the destination device or port to which it applies.

The following addressing modes can be used to define the IB ports:

- Using a Directed Route to the destination: (Tool option '-d')

 This option defines a directed route of output port numbers from the local port to the destination.
- Using port LIDs: (Tool option '-l'):
 In this mode, the source and destination ports are defined by means of their LIDs. If the fabric is configured to allow multiple LIDs per port, then using any of them is valid for defining a port.
- Using port names defined in the topology file: (Tool option '-n')

 This option refers to the source and destination ports by the names defined in the topology file. (Therefore, this option is relevant only if a topology file is specified to the tool.) In this mode, the tool uses the names to extract the port LIDs from the matched topology, then the tool operates as in the '-l' option.

Diagnostic Utilities

The diagnostic utilities described in this chapter provide means for debugging the connectivity and status of InfiniBand (IB) devices in a fabric.

Diagnostic Utilities

Utili ty	Description
du mp _fts	Dumps tables for every switch found in an ibnetdiscover scan of the subnet. The dump file format is compatible with loading into OpenSM using the -R file -U /path/to/dump-file syntax. For further information, please refer to the tool's man page.
iba ddr	Can be used to show the LID and GID addresses of the specified port or the local port by default. This utility can be used as simple address resolver. For further information, please refer to the tool's man page.

Utili ty	Description
ibc ach eed it	Allows users to edit an ibnetdiscover cache created through thecache option in ibnetdiscover(8). For further information, please refer to the tool's man page.
ibcc con fig	Supports the configuration of congestion control settings on switches and HCAs. For further information, please refer to the tool's man page.
ibcc que ry	Supports the querying of settings and other information related to congestion control. For further information, please refer to the tool's man page.
ibc ong est	Provides static congestion analysis. It calculates routing for a given topology (topomode) or uses extracted lst/fdb files (lst-mode). Additionally, it analyzes congestion for a traffic schedule provided in a "schedule-file" or uses an automatically generated schedule of all-to-all-shift. To display a help message which details the tool's options, please run "/opt/ibutils2/bin/ibcongest -h". For further information, please refer to the tool's man page.
ibd ev2 net dev	Enables association between IB devices and ports and the associated net device. Additionally it reports the state of the net device link. For further information, please refer to the tool's man page.
ibdi agn et (of ibu tils 2)	Scans the fabric using directed route packets and extracts all the available information regarding its connectivity and devices. An ibdiagnet run performs the following stages: • Fabric discovery • Duplicated GUIDs detection • Links in INIT state and unresponsive links detection • Counters fetch • Error counters check • Routing checks • Link width and speed checks • Alias GUIDs check • Subnet Manager check • Partition keys check • Nodes information

Utili Description ty **Note:** This version of ibdiagnet is included in the ibutils2 package, and it is run by default after installing NVIDIA OFED. To use this ibdiagnet version, run: ibdiagnet. For further information, either: 1. Run ibdiagnet -H Or 2. Refer to docs.nvidia.com/networking/display/ibdiagnetUserManualv10 Traces a path between two end-points and provides information regarding the nodes and ports traversed along the path. It utilizes device specific health queries for the different devices along the path. The way ibdiagpath operates depends on the addressing mode used in the command line. If directed route addressing is used (--dr_path flag), the local node is the source node and the route to the destination port is known apriori (for ibdi example: ibdiagpath --dr_path 0,1). On the other hand, if LID-route addressing is agp employed, --src_lid and --dest_lid, then the source and destination ports of a route ath are specified by their LIDs. In this case, the actual path from the local port to the source port, and from the source port to the destination port, is defined by means of Subnet Management Linear Forwarding Table queries of the switch nodes along that path. Therefore, the path cannot be predicted as it may change. Example: ibdiagpath --src_lid 1 --dest_lid 28 For further information, please refer to the tool's -help flag. ibd Dump InfiniBand traffic that flows to and from NVIDIA's ConnectX® family adapters InfiniBand ports. um Note the following: p ibdump is not supported for Virtual functions (SR-IOV) • Infiniband traffic sniffing is supported on all HCAs The dump file can be loaded by the Wireshark tool for graphical traffic analysis. The following describes a workflow for local HCA (adapter) sniffing: 1. Run ibdump with the desired options 2. Run the application that you wish its traffic to be analyzed 3. Stop ibdump (CTRL-C) or wait for the data buffer to fill (in --mem-mode) 4. Open Wireshark and load the generated file To download Wireshark for a Linux or Windows environment go to www.wireshark.org.

Notes:

Utili ty	Description
	 Although ibdump is a Linux application, the generated .pcap file may be analyzed on either operating system. If one of the HCA's ports is configured as InfiniBand, ibdump requires IPoIB DMFS to be enabled. For further information, please refer to Flow Steering Configuration section. For further information, please refer to the tool's man page.
ibli nki nfo	Reports link info for each port in an InfiniBand fabric, node by node. Optionally, iblinkinfo can do partial scans and limit its output to parts of a fabric. For further information, please refer to the tool's man page.
ibn etdi sco ver	Performs InfiniBand subnet discovery and outputs a human readable topology file. GUIDs, node types, and port numbers are displayed as well as port LIDs and node descriptions. All nodes (and links) are displayed (full topology). This utility can also be used to list the current connected nodes. The output is printed to the standard output unless a topology file is specified. For further information, please refer to the tool's man page.
ibn ets plit	Automatically groups hosts and creates scripts that can be run in order to split the network into sub-networks containing one group of hosts. For further information, please refer to the tool's man page.
ibn ode s	Uses the current InfiniBand subnet topology or an already saved topology file and extracts the InfiniBand nodes (CAs and switches). For further information, please refer to the tool's man page.
ibpi ng	Uses vendor mads to validate connectivity between InfiniBand nodes. On exit, (IP) ping like output is show. ibping is run as client/server. The default is to run as client. Note also that a default ping server is implemented within the kernel. For further information, please refer to the tool's man page.
ibp orts tat e	Enables querying the logical (link) and physical port states of an InfiniBand port. It also allows adjusting the link speed that is enabled on any InfiniBand port. If the queried port is a switch port, then ibportstate can be used to:
	disable, enable or reset the portvalidate the port's link width and speed against the peer port
	In case of multiple channel adapters (CAs) or multiple ports without a CA/ port being specified, a port is chosen by the utility according to the following criteria:

Utili ty	Description
	 The first ACTIVE port that is found. If not found, the first port that is UP (physical link state is LinkUp).
	For further information, please refer to the tool's man page.
ibq uer yer ror	The default behavior is to report the port error counters which exceed a threshold for each port in the fabric. The default threshold is zero (0). Error fields can also be suppressed entirely. In addition to reporting errors on every port, ibqueryerrors can report the port transmit and receive data as well as report full link information to the remote port if available. For further information, please refer to the tool's man page.
ibr out e	Uses SMPs to display the forwarding tables—unicast (LinearForwarding- Table or LFT) or multicast (MulticastForwardingTable or MFT)—for the specified switch LID and the optional lid (mlid) range. The default range is all valid entries in the range 1 to FDBTop. For further information, please refer to the tool's man page.
ibst at	ibstat is a binary which displays basic information obtained from the local IB driver. Output includes LID, SMLID, port state, link width active, and port physical state. For further information, please refer to the tool's man page.
ibst atu s	Displays basic information obtained from the local InfiniBand driver. Output includes LID, SMLID, port state, port physical state, port width and port rate. For further information, please refer to the tool's man page.
ibs wit che s	Traces the InfiniBand subnet topology or uses an already saved topology file to extract the InfiniBand switches. For further information, please refer to the tool's man page.
ibsy sst at	Uses vendor mads to validate connectivity between InfiniBand nodes and obtain other information about the InfiniBand node. ibsysstat is run as client/ server. The default is to run as client. For further information, please refer to the tool's man page.
ibto pod iff	Compares a topology file and a discovered listing ofsubnet.lst/ibdiagnet.lst and reports mismatches. Two different algorithms provided:

Utili	
ty	Description
	 Using the -e option is more suitable for MANY mismatches it applies less heuristics and provide details about the match Providing the -s, -p and -g starts a detailed heuristics that should be used when only small number of changes are expected
	For further information, please refer to the tool's man page.
ibtr ace rt	Uses SMPs to trace the path from a source GID/LID to a destination GID/ LID. Each hop along the path is displayed until the destination is reached or a hop does not respond. By using the -m option, multicast path tracing can be performed between source and destination nodes. For further information, please refer to the tool's man page.
ibv_ asy nc wat ch	Display asynchronous events forwarded to userspace for an InfiniBand device. For further information, please refer to the tool's man page.
ibv_ dev ices	Lists InfiniBand devices available for use from userspace, including node GUIDs. For further information, please refer to the tool's man page.
ibv_ dev info	Queries InfiniBand devices and prints about them information that is available for use from userspace. For further information, please refer to the tool's man page.
mst flin t	Queries and burns a binary firmware-image file on non-volatile (Flash) memories of NVIDIA InfiniBand and Ethernet network adapters. The tool requires root privileges for Flash access. To run mstflint, you must know the device location on the PCI bus. Note: If you purchased a standard NVIDIA network adapter card, please download the firmware image from nvidia.com/en-us/networking/ Support Support Firmware Download. If you purchased a non-standard card from a vendor other than NVIDIA, please contact your vendor. For further information, please refer to the tool's man page.
per fqu ery	Queries InfiniBand ports' performance and error counters. Optionally, it displays aggregated counters for all ports of a node. It can also reset counters after reading them or simply reset them. For further information, please refer to the tool's man page.

Utili ty	Description
saq uer y	Issues the selected SA query. Node records are queried by default. For further information, please refer to the tool's man page.
smi nfo	Issues and dumps the output of an sminfo query in human readable format. The target SM is the one listed in the local port info or the SM specified by the optional SM LID or by the SM direct routed path. Note: Using sminfo for any purpose other than a simple query might result in a malfunction of the target SM. For further information, please refer to the tool's man page.
sm par que ry	Sends SMP query for adaptive routing and private LFT features. For further information, please refer to the tool's man page.
sm pdu mp	A general purpose SMP utility which gets SM attributes from a specified SMA. The result is dumped in hex by default. For further information, please refer to the tool's man page.
sm pqu ery	Provides a basic subset of standard SMP queries to query Subnet management attributes such as node info, node description, switch info, and port info. For further information, please refer to the tool's man page.

Link Level Retransmission (LLR) in FDR Links

With the introduction of FDR 56 Gbps technology, NVIDIA enabled a proprietary technology called LLR (Link Level Retransmission) to improve the reliability of FDR links.

This proprietary LLR technology adds additional CRC checking to the data stream and retransmits portions of packets with CRC errors at the local link level. Customers should be aware of the following facts associated with LLR technology:

- Traditional methods of checking the link health can be masked because the LLR technology automatically fixes errors. The traditional IB symbol error counter will show no errors when LLR is active.
- Latency of the fabric can be impacted slightly due to LLR retransmissions.

 Traditional IB performance utilities can be used to monitor any latency impact.

 Bandwidth of links can be reduced if cable performance degrades and LLR retransmissions become too numerous. Traditional IB bandwidth performance utilities can be used to monitor any bandwidth impact.

Due to these factors, an LLR retransmission rate counter has been added to the ibdiagnet utility that can give end users an indication of the link health.

To monitor LLR retransmission rate:

- 1. Run ibdiagnet, no special flags required.
- 2. If the LLR retransmission rate limit is exceeded it will print to the screen.
- 3. The default limit is set to 500 and requires further investigation if exceeded.
- 4. The LLR retransmission rate is reflected in the results file /var/tmp/ibdiagnet2/<u>ibdiagnet2.pm</u>.

The default value of 500 retransmissions/sec has been determined by NVIDIA based on the extensive simulations and testing. Links exhibiting a lower LLR retransmission rate should not raise special concern.

Performance Utilities

The performance utilities described in this chapter are intended to be used as a performance micro-benchmark.

Utili ty	Description
ib_a tom ic_b w	Calculates the BW of RDMA Atomic transactions between a pair of machines. One acts as a server and the other as a client. The client RDMA sends atomic operation to the server and calculate the BW by sampling the CPU each time it receive a successful completion. The test supports features such as Bidirectional, in which they both RDMA atomic to each other at the same time, change of MTU size, tx size, number of iteration, message size and more. Using the "-a" flag provides results for all message sizes. For further information, please refer to the tool's man page.

Utili ty	Description
ib_a tom ic_la t	Calculates the latency of RDMA Atomic transaction of message_size between a pair of machines. One acts as a server and the other as a client. The client sends RDMA atomic operation and sample the CPU clock when it receives a successful completion, in order to calculate latency. For further information, please refer to the tool's man page.
ib_r ead _bw	Calculates the BW of RDMA read between a pair of machines. One acts as a server and the other as a client. The client RDMA reads the server memory and calculate the BW by sampling the CPU each time it receive a successful completion. The test supports features such as Bidirectional, in which they both RDMA read from each other memory's at the same time, change of MTU size, tx size, number of iteration, message size and more. Read is available only in RC connection mode (as specified in IB spec). For further information, please refer to the tool's man page.
ib_r ead _lat	Calculates the latency of RDMA read operation of message_size between a pair of machines. One acts as a server and the other as a client. They perform a ping pong benchmark on which one side RDMA reads the memory of the other side only after the other side have read his memory. Each of the sides samples the CPU clock each time they read the other side memory, in order to calculate latency. Read is available only in RC connection mode (as specified in IB spec). For further information, please refer to the tool's man page.
ib_s end _bw	Calculates the BW of SEND between a pair of machines. One acts as a server and the other as a client. The server receive packets from the client and they both calculate the throughput of the operation. The test supports features such as Bidirectional, on which they both send and receive at the same time, change of MTU size, tx size, number of iteration, message size and more. Using the "-a" provides results for all message sizes. For further information, please refer to the tool's man page.
ib_s end _lat	Calculates the latency of sending a packet in message_size between a pair of machines. One acts as a server and the other as a client. They perform a ping pong benchmark on which you send packet only if you receive one. Each of the sides samples the CPU each time they receive a packet in order to calculate the latency. Using the "-a" provides results for all message sizes. For further information, please refer to the tool's man page.
ib_ writ	Calculates the BW of RDMA write between a pair of machines. One acts as a server and the other as a client. The client RDMA writes to the server memory

Utili ty	Description		
e_b w	and calculates the BW by sampling the CPU each time it receives a successful completion. The test supports features such as Bidirectional, in which they both RDMA write to each other at the same time, change of MTU size, tx size, number of iteration, message size and more. Using the "-a" flag provides results for all message sizes. For further information, please refer to the tool's man page.		
ib_ writ e_la t	Calculates the latency of RDMA write operation of message_size between a pair of machines. One acts as a server and the other as a client. They perform a ping pong benchmark on which one side RDMA writes to the other side memory only after the other side wrote on his memory. Each of the sides samples the CPU clock each time they write to the other side memory, in order to calculate latency. For further information, please refer to the tool's man page.		
raw _eth ern et_b w	Bidirectional, on which they both send and receive at the same time, change of		
raw _eth ern et_l at	Calculates the latency of sending a packet in message_size between a pair of machines. One acts as a server and the other as a client. They perform a ping pong benchmark on which you send packet only if you receive one. Each of the sides samples the CPU each time they receive a packet in order to calculate the latency. Using the "-a" provides results for all message sizes. For further information, please refer to the tool's man page.		

Troubleshooting

You may be able to easily resolve the issues described in this section. If a problem persists and you are unable to resolve it yourself, please contact your NVIDIA representative or NVIDIA Support at networking-support@nvidia.com.

.

The chapter contains the following sections:

- General Issues
- Ethernet Related Issues
- InfiniBand Related Issues
- Installation Related Issues
- Performance Related Issues
- SR-IOV Related Issues
- PXE (FlexBoot) Related Issues
- RDMA Related Issues
- <u>Debugging Related Issues</u>
- OVS Offload Using ASAP2 Direct Related Issues

Common Abbreviations and Related Documents

Common Abbreviations and Acronyms

Abbreviation/ Acronym	Description	
В	(Capital) 'B' is used to indicate size in bytes or multiples of bytes (e.g., 1KB = 1024 bytes, and 1MB = 1048576 bytes)	
b	(Small) 'b' is used to indicate size in bits or multiples of bits (e.g., 1Kb = 1024 bits)	
FW	Firmware	
HCA	Host Channel Adapter	
HW	Hardware	
IB	InfiniBand	

Abbreviation/ Acronym	Description	
iSER	iSCSI RDMA Protocol	
LSB	Least significant <i>byte</i>	
lsb	Least significant <i>bit</i>	
MSB	Most significant <i>byte</i>	
msb	Most significant <i>bit</i>	
NIC	Network Interface Card	
SW	Software	
VPI	Virtual Protocol Interconnect	
IPolB	IP over InfiniBand	
PFC	Priority Flow Control	
PR	Path Record	
RoCE	RDMA over Converged Ethernet	
SL	Service Level	
SRP	SCSI RDMA Protocol	
MPI	Message Passing Interface	
QoS	Quality of Service	
ULP	Upper Layer Protocol	
VL	Virtual Lane	
vHBA	Virtual SCSI Host Bus Adapter	
uDAPL	User Direct Access Programming Library	

Glossary

The following is a list of concepts and terms related to InfiniBand in general and to Subnet Managers in particular. It is included here for ease of reference, but the main reference remains the *InfiniBand Architecture Specification*.

Term	Description	
Channel Adapter (CA), Host Channel Adapter (HCA)	An IB device that terminates an IB link and executes transport functions. This may be an HCA (Host CA) or a TCA (Target CA)	
HCA Card	A network adapter card based on an InfiniBand channel adapter device	
IB Devices	An integrated circuit implementing InfiniBand compliant communication	
IB Cluster/Fabric/ Subnet	A set of IB devices connected by IB cables	
In-Band	A term assigned to administration activities traversing the IB connectivity only	
Local Identifier (ID)	An address assigned to a port (data sink or source point) by the Subnet Manager, unique within the subnet, used for directing packets within the subnet	
Local Device/Node/ System	The IB Host Channel Adapter (HCA) Card installed on the machine running IBDIAG tools	
Local Port	The IB port of the HCA through which IBDIAG tools connect to the IB fabric	
Master Subnet Manager	The Subnet Manager that is authoritative, that has the reference configuration information for the subnet	
Multicast Forwarding Tables	A table that exists in every switch providing the list of ports to forward received multicast packet. The table is organized by MLID	
Network Interface Card (NIC)	A network adapter card that plugs into the PCI Express slot and provides one or more ports to an Ethernet network	
Standby Subnet Manager	A Subnet Manager that is currently quiescent, and not in the role of a Master Subnet Manager, by the agency of the master SM	
Subnet Administrator (SA) An application (normally part of the Subnet Manager) the implements the interface for querying and manipulating management data		
Subnet Manager (SM)	One of several entities involved in the configuration and control of the IB fabric	

Term	Description	
Unicast Linear Forwarding Tables (LFT)	A table that exists in every switch providing the port through which packets should be sent to each LID	
Virtual Protocol Interconnect (VPI)	An NVIDIA technology that allows NVIDIA channel adapter devices (ConnectX®) to simultaneously connect to an InfiniBand subnet and a 10GigE subnet (each subnet connects to one of the adapter ports)	

Related Documentation

Document Name	Description
InfiniBand Architecture Specification, Vol. 1, Release 1.2.1	The InfiniBand Architecture Specification that is provided by IBTA
IEEE Std 802.3ae™-2002 (Amendment to IEEE Std 802.3-2002) Document # PDF: SS94996	Part 3: Carrier Sense Multiple Access with Collision Detection (CSMA/CD) Access Method and Physical Layer Specifications Amendment: Media Access Control (MAC) Parameters, Physical Layers, and Management Parameters for 10 Gb/s Operation
Firmware Release Notes for NVIDIA adapter devices	See the <u>Release Notes</u> relevant to your adapter device
MFT User Manual and Release Notes	NVIDIA Firmware Tools (MFT) User Manual and Release Notes documents
WinOF User Manual	Mellanox WinOF User Manual describes the installation, configuration, and operation of NVIDIA Windows driver
VMA User Manual	NVIDIA VMA User Manual describes the installation, configuration, and operation of NVIDIA VMA driver

Documentation History

- Release Notes History
- User Manual Revision History

Release Notes History

- Changes and New Features History
- Bug Fixes History

User Manual Revision History

Releas e	Date	Description	
23.10	November 2023	 Added <u>IPsec Full Offload</u> Added a note to <u>NVME-oF - NVM Express over Fabrics</u>. 	
	September 2023	No changes to the User Manual.	
23.07	August 2023	 Updated "Interrupt Request (IRQ) Naming" under Ethernet Interface. Removed the "IPsec Crypto Offload" section from the Ethernet Network chapter. Removed all "Connected Mode" indications, and the "IPoIB Mode Setting" section from IP over InfiniBand (IPoIB). Removed Running OpenSM, and updated Running OpenSM as Daemon under NVIDIA SM. 	

Releas e	Date	Description	
23.04	May 2023	 Removed "Installing NEO-Host Using mlnxofedinstall Script" subsection from the <u>Installing MLNX_OFED</u> section Added note under "<u>Enrolling NVIDIA's x.509 Public Key On your Systems</u>" subsection in the <u>UEFI Secure Boot section</u> Updated the <u>NVIDIA SM</u> (OpenSM) section 	
	Jun 2023	Added an important note to <u>IPsec Crypto Offload</u>	
5.7	August 2022	 Added <u>Out of Order (OOO)</u> under RoCE section Added section describing <u>Dumping Steering Info</u> 	
5.6	April 2022	 Added <u>OpenFlow Meters</u> section Added <u>Installation on Community Operating Systems</u> section 	
5.5	December 2021	 Added "Forward to Multiple Destinations" section Added "Open vSwitch Metering" section Added "Multiport eSwitch Mode" section Added "Bridge Offload" section Added "TC Configuration for ConnectX-6 Dx and Above" subsection 	
5.4-3	October 2021	Removed <u>LASH Routing Algorithm</u>	
5.4-2	August 2021	 Added <u>CT CT NAT</u> section Added <u>Representor Metering</u> section Updated <u>VF Metering</u> section Removed sysfs VXLAN portion of the <u>Enabling VXLAN</u> <u>Hardware Stateless Offloads</u> section 	
5.4	June 2021	Updated <u>SR-IOV Live Migration</u>	
5.3-1	March 31,2021	Added <u>PTP Cyc2time Hardware Translation Offload</u> section	

Releas e	Date	Description	
		 Added Connection Tracking Performance Tuning section Added VF Metering section Added note under OVS-DPDK Hardware Offloads section Updated Persistent Naming section Updated command under Connection Tracking Offload section Added sFlow description under OVS-DPDK Hardware Offloads section 	
	February 14, 2021	 Added <u>Setting up MLNX_OFED YUM Repository Using</u> add-kernel-support section Added <u>Setting up MLNX_OFED apt-get Repository Using</u> -add-kernel-support section 	
	January 19, 2021	Added <u>OpenSSL with kTLS Offload</u> section	
5.2	January 4, 2021	 Added Offloaded Traffic Sniffer section Added Tx Port Time-Stamping section Added VLAN Push/Pop section Added sFLOW section Added E2E Cache section Added Geneve Encapsulation/Decapsulation section Added Parallel Offloads section Updated SR-IOV VF LAG section Removed Installing MLNX_OFED on Innova™ IPsec Adapter Cards section Removed Updating Firmware and FPGA Image on Innova IPsec Cards section 	
5.1-2	September 17, 2020	Added <u>Packet Pacing for Hairpin Queues</u> section	
5.1	July 28, 2020	Updated the content of the entire document following the removal of support for ConnectX-3, ConnectX-3 Pro and Connect-IB adapter cards, as well as the deprecation of RDMA experimental verbs library (mlnx_lib)	

Releas e	Date	Description	
		Added <u>SR-IOV Live Migration</u> section	
		Added <u>SR-IOV VF LAG</u> section	
F 0 2	April 23, 2020	Added Interrupt Request (IRQ) Naming section	
5.0-2	April 6, 2020	Added <u>Kernel Transport Layer Security (kTLS) Offloads</u> section	
5.0	March 3, 2020	 Added <u>IPSec Crypto Offload</u> section Added <u>OVS-DPDK Hardware Offloads</u> section Updated <u>OVS Hardware Offloads Configuration</u> section 	
	December 29, 2019	Added <u>Configuring Uplink Representor Mode</u> section	
4.7	December 13, 2019	 Added <u>Performance Tuning Based on Traffic Patterns</u> section Added "num_of_groups" entry to table <u>mlx5_core</u> <u>Module Parameters</u> Added <u>.Mediated Devices v5.4-0.5.1.1-Beta</u> section 	
	September 29, 2019	Updated <u>Additional Installation Procedures</u> section	
	May 13, 2019	ethtool section updates: Added description of -f flashing option to Ethtool Supported Options table	
4.6	April 30, 2019	 ethtool section updates: Updated the description of ethtool -s eth<x> advertise <n> autoneg on counter under Ethtool</n></x> Added the following counters under Ethtool:	

Releas e	Date	Description	
4.5	December 19, 2018	 Reorganized Chapter 2, "Installation": Consolidated the separate installation procedures under <u>Installing NVIDIA</u> <u>OFED</u> and <u>Additional Installation Procedures</u> Added <u>Installing NEO-Host Using mlnxofedinstall Script</u> 	
4.5	November 29, 2018	 Added the following sections: Local Loopback Disable Offsweep Balancing 	

Legal Notices and 3rd Party Licenses

The following are the drivers' software, tools and HCA firmware legal notices and 3rd party licenses.

Product	Version	Legal Notices and 3rd Party Licenses
MLNX_OFED	23.10-2.1.3.1	<u>License</u><u>3rd Part Notice</u>
Firmware	xx.39.3004	 HCA Firmware EULA 3rd Party Unify Notice License
MFT	4.26.1	<u>License</u><u>3rd Party Notice</u>
Clusterkit	1.11	<u>License</u><u>3rd Party Notice</u>
DPCP	1.1.43	<u>License</u><u>3rd Party Notice</u>
VMA	9.8.40	 3rd Party Unify Notice 3rd Party Notice
XLIO	3.20.8	<u>License</u><u>3rd Party Unify Notice</u>
HCOLL	4.8	<u>License</u><u>3rd Party Notice</u>

Product	Version	Legal Notices and 3rd Party Licenses
SHARP	3.5.1	<u>License</u><u>3rd Party Notice</u>
ibutils2	2.15	<u>License</u><u>3rd Party Notice</u>
OpenSM	5.17.0.1	3rd Party Unify Notice3rd Party Notice
mpitests	3.2.21	<u>License</u><u>3rd Party Notice</u>

[©] Copyright 2024, NVIDIA. PDF Generated on 06/06/2024