

NVIDIA Virtual GPU Software for XenServer Release Notes

Release 21.0

NVIDIA Corporation

Nov 05, 2026

Contents

1 Release Notes **1**
1.1 NVIDIA vGPU Software Driver Versions . . . 1
1.2 Compatibility Requirements for the NVIDIA vGPU Manager and Guest VM Driver . . . 1
1.2.1 Compatible NVIDIA vGPU Manager and Guest VM Driver Releases . . . 2
1.2.2 Incompatible NVIDIA vGPU Manager and Guest VM Driver Releases . . . 2
1.3 Updates in Release 21.0 . . . 3
1.3.1 New Features in Release 21.0 . . . 3
1.3.2 Hardware and Software Support Introduced in Release 21.0 . . . 3
1.3.3 Features Deprecated in Release 21.0 . . . 3

2 Validated Platforms **5**
2.1 Supported NVIDIA GPUs and Validated Server Platforms . . . 5
2.1.1 GPUs Based on the NVIDIA Blackwell Architecture . . . 5
2.1.2 GPUs Based on the NVIDIA Ada Lovelace Architecture . . . 6
2.1.3 GPUs Based on the NVIDIA Ampere Architecture . . . 9
2.1.4 GPUs Based on the NVIDIA Turing Architecture . . . 11
2.1.5 Support for a Mixture of Time-Sliced vGPU Types on the Same GPU . . . 11
2.1.6 Switching the Mode of a GPU that Supports Multiple Display Modes . . . 12
2.2 Hypervisor Software Releases . . . 12
2.2.1 Reversion to the XenServer Name for Hypervisor Software . . . 13
2.2.2 Supported XenServer Releases . . . 13
2.2.3 Supported Virtual Desktop Software Releases . . . 13
2.3 Guest OS Support . . . 14
2.3.1 Windows Guest OS Support . . . 14
2.3.1.1 Windows Guest OS Support in Release 21.0 . . . 15
2.3.2 Linux Guest OS Support . . . 15
2.3.2.1 Linux Guest OS Support in Release 21.0 . . . 15
2.4 NVIDIA CUDA Toolkit Version Support . . . 16
2.5 Wayland Display Server Protocol Support . . . 16
2.5.1 Supported GPUs . . . 16
2.5.2 Supported Guest OS Releases . . . 16
2.5.3 Supported Display Resolutions . . . 17
2.5.4 Limitations with Wayland Display Server Protocol Support . . . 17
2.5.5 Known Issues with Wayland Display Server Protocol Support . . . 17
2.6 XenMotion with vGPU Support . . . 17
2.6.1 Limitations with XenMotion with vGPU Support . . . 17
2.6.2 Supported Hypervisor Software Releases . . . 18
2.6.3 Supported Guest OS Releases . . . 18
2.6.4 Known Issues with XenMotion with vGPU Support . . . 18
2.7 Multiple vGPU Support . . . 18
2.7.1 vGPUs that Support Multiple vGPUs Assigned to a VM . . . 18
2.7.1.1 Multiple vGPU Support on the NVIDIA Blackwell Architecture . . . 19
2.7.1.2 Multiple vGPU Support on the NVIDIA Ada Lovelace Architecture . . . 19

2.7.1.3 Multiple vGPU Support on the NVIDIA Ampere GPU Architecture . . . 19
2.7.1.4 Multiple vGPU Support on the NVIDIA Turing GPU Architecture . . . 20
2.7.2 Maximum Number of vGPUs Supported per VM . . . 20
2.7.3 Hypervisor Releases that Support Multiple vGPUs Assigned to a VM . . . 20
2.8 Peer-to-Peer CUDA Transfers over NVLink Support . . . 20
2.8.1 vGPUs that Support Peer-to-Peer CUDA Transfers . . . 20
2.8.1.1 Peer-to-Peer CUDA Transfer Support on the NVIDIA Ampere GPU Architecture 20
2.8.1.2 Peer-to-Peer CUDA Transfer Support on the NVIDIA Turing GPU Architecture . 21
2.8.1.3 Peer-to-Peer CUDA Transfer Support on the NVIDIA Volta GPU Architecture . . 21
2.8.2 Hypervisor Releases that Support Peer-to-Peer CUDA Transfers . . . 21
2.8.3 Guest OS Releases that Support Peer-to-Peer CUDA Transfers . . . 21
2.8.4 Limitations on Support for Peer-to-Peer CUDA Transfers . . . 21
2.9 Unified Memory Support . . . 21
2.9.1 vGPUs that Support Unified Memory . . . 22
2.9.1.1 Unified Memory Support on the NVIDIA Blackwell GPU Architecture . . . 22
2.9.1.2 Unified Memory Support on the NVIDIA Ada Lovelace GPU Architecture . . . 22
2.9.1.3 Unified Memory Support on the NVIDIA Ampere GPU Architecture . . . 23
2.9.2 Guest OS Releases that Support Unified Memory . . . 23
2.9.3 Limitations on Support for Unified Memory . . . 23
2.10 Microsoft Compute Driver Model (MCDM) Support . . . 23
2.10.1 Supported vGPUs . . . 23
2.10.2 Supported GPUs . . . 23
2.10.3 Supported Guest OS Releases . . . 24
2.11 NVIDIA Deep Learning Super Sampling (DLSS) Support . . . 24

3 Known Product Limitations **27**
3.1 vGPUs of different types on the same GPU are not supported . . . 27
3.2 Maximum Allowed Network Adapters on a VM . . . 27
3.3 NVENC does not support resolutions greater than 4096×4096 . . . 27
3.3.1 Description . . . 27
3.3.2 Workaround . . . 28
3.4 Nested Virtualization Is Not Supported by NVIDIA vGPU . . . 28
3.5 Issues occur when the channels allocated to a vGPU are exhausted . . . 28
3.5.1 Description . . . 28
3.5.2 Workaround . . . 29
3.6 Total frame buffer for vGPUs is less than the total frame buffer on the physical GPU . . 29
3.7 Issues may occur with graphics-intensive OpenCL applications on vGPU types with limited frame buffer . . . 30
3.7.1 Description . . . 30
3.7.2 Workaround . . . 31
3.8 In pass through mode, all GPUs connected to each other through NVLink must be assigned to the same VM . . . 31
3.8.1 Description . . . 31
3.8.2 Workaround . . . 31
3.9 VM running an incompatible NVIDIA vGPU guest driver fails to initialize vGPU when booted . . . 31
3.9.1 Description . . . 31
3.9.2 Resolution . . . 32
3.10 Single vGPU benchmark scores are lower than pass-through GPU . . . 32
3.10.1 Description . . . 32
3.10.2 Resolution . . . 32
3.11 `nvidia-smi` fails to operate when all GPUs are assigned to GPU pass-through mode . 33
3.11.1 Description . . . 33
3.11.2 Resolution . . . 34

3.12 Windows Aero is disabled on Citrix Virtual Apps and Desktops session using 3 or 4 monitors in 2560×1600 resolution . . . 34
3.12.1 Description . . . 34
3.13 VMs configured with large memory fail to initialize vGPU when booted . . . 35
3.13.1 Description . . . 35
3.13.2 Resolution . . . 35
3.14 vGPU host driver RPM upgrade fails . . . 36
3.14.1 Description . . . 36
3.14.2 Resolution . . . 36

4 Resolved Issues **37**
4.1 Issues Resolved in Release 21.2 . . . 37
4.2 Issues Resolved in Release 21.1 . . . 37
4.3 Issues Resolved in Release 21.0 . . . 37

5 Known Issues **39**

6 Notices **41**

Chapter 1. Release Notes

These *Release Notes* summarize current status, information on validated platforms, and known issues with NVIDIA vGPU software and associated hardware on XenServer.

1.1. NVIDIA vGPU Software Driver Versions

Each release in this release family of NVIDIA vGPU software includes a specific version of the NVIDIA Virtual GPU Manager, NVIDIA Windows driver, and NVIDIA Linux driver.

NVIDIA vGPU Software Version	NVIDIA Virtual GPU Manager Version	NVIDIA Windows Driver Version	NVIDIA Linux Driver Version
21.0	620.70.04	621.14	620.70.06

For details of which XenServer releases are supported, see *Hypervisor Software Releases*.

1.2. Compatibility Requirements for the NVIDIA vGPU Manager and Guest VM Driver

The releases of the NVIDIA vGPU Manager and guest VM drivers that you install must be compatible. If you install an incompatible guest VM driver release for the release of the vGPU Manager that you are using, the NVIDIA vGPU fails to load.

See *VM running an incompatible NVIDIA vGPU guest driver fails to initialize vGPU when booted*.

Note

You must use NVIDIA License System with every release in this release family of NVIDIA vGPU software. All releases in this release family of NVIDIA vGPU software are **incompatible** with all releases of the NVIDIA vGPU software license server.

1.2.1. Compatible NVIDIA vGPU Manager and Guest VM Driver Releases

The following combinations of NVIDIA vGPU Manager and guest VM driver releases are compatible with each other.

- NVIDIA vGPU Manager with guest VM drivers from the same release
- NVIDIA vGPU Manager from a later major release branch with guest VM drivers from the previous branch
- NVIDIA vGPU Manager from a later long-term support branch with guest VM drivers from the previous long-term support branch

Note

When NVIDIA vGPU Manager is used with guest VM drivers from the previous branch, the combination supports **only** the features, hardware, and software (including guest OSes) that are supported on both releases.

For example, if vGPU Manager from release 21.0 is used with guest drivers from release 16.4, the combination does **not** support Windows Server 2019 because NVIDIA vGPU software release 21.0 does not support Windows Server 2019.

The following table lists the specific software releases that are compatible with the components in the NVIDIA vGPU software 21 major release branch.

NVIDIA vGPU Software Component	Release	Compatible Software Releases
NVIDIA vGPU Manager	21.0	▶ Guest VM driver release 21.0 ▶ All guest VM driver 20.<x> releases ▶ All guest VM driver 19.<x> releases
Guest VM drivers	21.0	NVIDIA vGPU Manager release 21.0

1.2.2. Incompatible NVIDIA vGPU Manager and Guest VM Driver Releases

The following combinations of NVIDIA vGPU Manager and guest VM driver releases are incompatible with each other.

- NVIDIA vGPU Manager from a later major release branch with guest VM drivers from a production branch two or more major releases before the release of the vGPU Manager
- NVIDIA vGPU Manager from an earlier major release branch with guest VM drivers from a later branch

The following table lists the specific software releases that are incompatible with the components in the NVIDIA vGPU software 21 major release branch.

NVIDIA vGPU Software Component	Release	Incompatible Software Releases
NVIDIA vGPU Manager	21.0	All guest VM driver releases 19.<x> and earlier, **except** 19.<x> releases
Guest VM drivers	21.0	All NVIDIA vGPU Manager releases 20.<x> and earlier

1.3. Updates in Release 21.0

1.3.1. New Features in Release 21.0

- `nvidia-xid-logd` support for GPU bind and unbind events

  The service is enabled by default and automatically releases its GPU reference on unbind and resumes monitoring on rebind. You no longer need to stop or disable the service before switching a GPU between vGPU and pass-through modes.
- Support for vGPU migration when NVIDIA CUDA Toolkit debuggers or profilers are enabled
- Support for hardware-accelerated GPU scheduling for a vGPU
- Support for the Microsoft Compute Driver Model (MCDM)
- Notification to guest VMs of when a GPU reset is required
- Console VNC support with the Wayland display server protocol
- Support for GPU performance monitoring (GPM) metrics through NVWMI
- Miscellaneous bug fixes as explained in *Issues Resolved in Release 21.0*

1.3.2. Hardware and Software Support Introduced in Release 21.0

- Newly supported guest OS releases:
  - Windows 11 26H2
- Newly supported remoting solutions:
  - Citrix Virtual Apps and Desktops version 7 2607

1.3.3. Features Deprecated in Release 21.0

The following table lists features that are deprecated in this release of NVIDIA vGPU software. Although the features remain available in this release, they might be withdrawn in a future release.

Deprecated Feature	Preferred Alternative	Additional Information
Tesla Compute Cluster (TCC) driver model	Microsoft Compute Driver Model (MCDM)	Enabling the Microsoft Compute Driver Model (MCDM)

Chapter 2. Validated Platforms

This release family of NVIDIA vGPU software provides support for several NVIDIA GPUs on validated server hardware platforms, XenServer hypervisor software versions, and guest operating systems. It also supports the version of NVIDIA CUDA Toolkit that is compatible with R620 drivers.

2.1. Supported NVIDIA GPUs and Validated Server Platforms

This release of NVIDIA vGPU software on XenServer provides support for several NVIDIA GPUs running on validated server hardware platforms.

For a list of validated server platforms, refer to NVIDIA GRID Certified Servers.

The supported products for each type of NVIDIA vGPU software deployment depend on the GPU.

2.1.1. GPUs Based on the NVIDIA Blackwell Architecture

Note

GPUs based on the NVIDIA Blackwell architecture support SR-IOV.

The manual placement of vGPUs on GPUs in equal-size mode **is not** supported on GPUs based on the NVIDIA Blackwell architecture.

GPU	Mixed vGPU Configuration - XenServer Releases		Supported NVIDIA vGPU Software Products[1,2,3]			
	Frame Buffer Size (Mixed-Size Mode)	Series	Time-Sliced NVIDIA vGPU on Single-Instance GPU[4]	1:1 MIG-Backed NVIDIA vGPU[5]	Time-Sliced, MIG-Backed NVIDIA vGPU	GPU Pass Through
NVIDIA RTX PRO 6000 Blackwell Server Edition	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	N/A	N/A	▶ vWS ▶ vApps
NVIDIA RTX PRO 6000 Blackwell Server Edition liquid cooled	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	N/A	N/A	▶ vWS ▶ vApps
NVIDIA RTX PRO 4500 Blackwell Server Edition	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	N/A	N/A	▶ vWS ▶ vApps

2.1.2. GPUs Based on the NVIDIA Ada Lovelace Architecture

Note

GPUs based on the NVIDIA Ada Lovelace architecture support SR-IOV.

The manual placement of vGPUs on GPUs in equal-size mode **is not** supported on GPUs based on

[1] The supported products are as follows:
- vWS: NVIDIA RTX Virtual Workstation
- vPC: NVIDIA Virtual PC
- vApps: NVIDIA Virtual Applications

[2] N/A indicates that the deployment is not supported.
[3] vApps is supported only on Windows operating systems.
[4] A single-instance GPU is a GPU that is not partitioned into multiple GPU instances.
[5] A 1:1 MIG-backed NVIDIA vGPU is a MIG-backed vGPU that occupies an entire GPU instance.

the NVIDIA Ada Lovelace architecture.

GPU	Mixed vGPU Configuration - XenServer Releases Frame Buffer Size (Mixed-Size Mode)	Series	Supported NVIDIA vGPU Software Products[Page 6, 1],[Page 6, 2],[F NVIDIA vGPU	 GPU Pass Through
NVIDIA L40S	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA L40	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA L20	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA L20 liquid cooled	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA L4	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA L2	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA RTX 6000 Ada	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA RTX 5880 Ada	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA RTX 5000 Ada	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps

2.1.3. GPUs Based on the NVIDIA Ampere Architecture

Note

GPUs based on the NVIDIA Ampere architecture support SR-IOV.

The manual placement of vGPUs on GPUs in equal-size mode **is not** supported on GPUs based on the NVIDIA Ampere architecture.

GPU	Mixed vGPU Configuration - XenServer Releases Frame Buffer Size (Mixed-Size Mode)	Series	Supported NVIDIA vGPU Software Products[Page 6, 1],[Page 6, 2],[F NVIDIA vGPU	 GPU Pass Through
NVIDIA A40[6]	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA A16	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA A10	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA A2	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA RTX A6000[6]	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA RTX A5500[6]	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps
NVIDIA RTX A5000[6]	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps

[6] This GPU is supported only in displayless mode. In displayless mode, local physical display connectors are disabled.

2.1.4. GPUs Based on the NVIDIA Turing Architecture

Note

SR-IOV and the manual placement of vGPUs on GPUs in equal-size mode are **not** supported on GPUs based on the NVIDIA Turing™ architecture.

GPU	Mixed vGPU Configuration - XenServer Releases		Supported NVIDIA vGPU Software Products[Page 6, 1],[Page 6, 2],[F	
	Frame Buffer Size (Mixed-Size Mode)	Series	NVIDIA vGPU	GPU Pass Through
Tesla T4	N/A	N/A	▶ vWS ▶ vPC ▶ vApps	▶ vWS ▶ vApps

2.1.5. Support for a Mixture of Time-Sliced vGPU Types on the Same GPU

XenServer does not support a mixture of different types of time-sliced vGPUs on the same physical GPU. All vGPUs on a single physical GPU must be of the same type: They must belong to the same vGPU series and be allocated the same amount of frame buffer.

For example, the following combinations of vGPUs are **not** supported on the same GPU:

- A40-2B and A40-2Q
- A40-2Q and A40-4Q
- A40-2B and A40-4Q

A mixture of time-sliced vGPUs from different virtual GPU series on the same server is not supported. Therefore, all vGPUs on different physical GPUs on the same card must belong to the same vGPU series. However, the requirement for all vGPUs to be allocated the same amount of frame buffer doesn't extend across physical GPUs on the same card. Different physical GPUs on the same card may host vGPUs with different amounts of frame buffer. For example, an NVIDIA A16 card has four physical GPUs, and can support several types of virtual GPU provided they all belong to the same vGPU series.

- A configuration with A16-16Q vGPUs on GPU 0 and GPU 1, A16-8Q vGPUs on GPU 2, and A16-4Q vGPUs on GPU3 is valid.
- A configuration with A16-4A vGPUs on GPU0 and A16-4Q vGPUs on GPU1 is invalid.
- A configuration with a mixture of A16-4A vGPUs and A16-4Q vGPUs on GPU0 is invalid.
- A configuration with a mixture of A16-8Q vGPUs and A16-4Q vGPUs on GPU0 is invalid.

2.1.6. Switching the Mode of a GPU that Supports Multiple Display Modes

Some GPUs support display-off and display-enabled modes but must be used in NVIDIA vGPU software deployments in display-off mode.

The GPUs listed in the following table support multiple display modes. As shown in the table, some GPUs are supplied from the factory in display-off mode, but other GPUs are supplied in a display-enabled mode.

GPU	Mode as Supplied from the Factory
NVIDIA A40	Display-off
NVIDIA L40	Display-off
NVIDIA L40S	Display-off
NVIDIA L20	Display-off
NVIDIA L20 liquid cooled	Display-off
NVIDIA RTX 5000 Ada	Display enabled
NVIDIA RTX 6000 Ada	Display enabled
NVIDIA RTX A5000	Display enabled
NVIDIA RTX A5500	Display enabled
NVIDIA RTX A6000	Display enabled
NVIDIA RTX PRO 6000 Blackwell Server Edition	Display-off
NVIDIA RTX PRO 6000 Blackwell Server Edition liquid cooled	Display-off

A GPU that is supplied from the factory in display-off mode, such as the NVIDIA A40 GPU, might be in a display-enabled mode if its mode has previously been changed.

To change the mode of a GPU that supports multiple display modes, use the `displaymodeselector` tool, which you can request from the NVIDIA Display Mode Selector Tool page on the NVIDIA Developer website.

Note

Only the GPUs listed in the table support the `displaymodeselector` tool. Other GPUs that support NVIDIA vGPU software do not support the `displaymodeselector` tool and, unless otherwise stated, do not require display mode switching.

2.2. Hypervisor Software Releases

2.2.1. Reversion to the XenServer Name for Hypervisor Software

Citrix has reverted the name of its hypervisor software for releases after Citrix Hypervisor 8.2 to XenServer.

For more information, visit the XenServer website.

Note

The name of the Citrix virtual desktop software product and the format of its release numbers remain unchanged.

2.2.2. Supported XenServer Releases

This release family of NVIDIA vGPU software is supported on the XenServer releases listed in the table.

Note

Support for XenServer requires the Premium Edition (previously Enterprise Edition) of XenServer. For details, see Licensing in the XenServer documentation.

Cumulative update releases for a base release of XenServer are compatible with the base release and can also be used with this version of NVIDIA vGPU software unless expressly stated otherwise.

Software	Releases Supported	Notes
XenServer 9	XenServer 9 and all updates to XenServer 9.	This release supports XenMotion with vGPU on suitable GPUs as listed in *XenMotion with vGPU Support*. The Virtual GPU Manager for this release is supplied **only** as a Supplemental Pack. No RPM package is supplied for this release.
XenServer 8.4	XenServer 8.4 and all updates to XenServer 8.4.	This release supports XenMotion with vGPU on suitable GPUs as listed in *XenMotion with vGPU Support*.

2.2.3. Supported Virtual Desktop Software Releases

This release supports **only** the virtual desktop software releases listed in the table. Except where otherwise stated, HDX 3D Pro mode is supported but not required.

Software	Releases Supported
Citrix Virtual Apps and Desktops	**Note** All versions supported by earlier NVIDIA vGPU software 21 releases are also supported. Versions 7 2607, 2603, 2511, 7 2507, 7 2503, 7 2411, 7 2407, 7 2402, 7 2311, 7 2308, 7 2305, 7 2303, 7 2212, 7 2209, 7 2206, 7 2203, 7 2112, 7 2109, 7 2106, 7 2103, 7 2012, 7 2009, 7 2006, 7 2003, 7 1912, 7 1909, 7 1906, and 7 1903
XenApp/XenDesktop	Version 7.15 **Note** Version 7.15 is supported **only** in HDX 3D Pro mode. HDX 3D Pro mode is required to ensure that the NVIDIA GPU can be used unrestricted.

2.3. Guest OS Support

NVIDIA vGPU software supports several Windows releases and Linux distributions as a guest OS. The supported guest operating systems depend on the hypervisor software version.

Note

Use only a guest OS release that is listed as supported by NVIDIA vGPU software with your virtualization software. To be listed as supported, a guest OS release must be supported not only by NVIDIA vGPU software, but also by your virtualization software. NVIDIA **cannot** support guest OS releases that your virtualization software does not support.

NVIDIA vGPU software supports **only** 64-bit guest operating systems. No 32-bit guest operating systems are supported.

2.3.1. Windows Guest OS Support

NVIDIA vGPU software supports **only** the 64-bit Windows releases listed as a guest OS on XenServer. The releases of XenServer for which a Windows release is supported depend on whether NVIDIA vGPU or pass-through GPU is used.

Note

If a specific release, even an update release, is not listed, it's **not** supported.

XenMotion with vGPU is supported on supported Windows guest OS releases.

2.3.1.1 Windows Guest OS Support in Release 21.0

- Windows Server 2025
- Windows Server 2022
- Windows 11 26H2 and all Windows 11 releases supported by Microsoft up to and including this release
- Windows 10 2022 Update (22H2) and all Windows 10 releases supported by Microsoft up to and including this release

> **Note**
>
> The hardware-accelerated GPU scheduling feature introduced in Windows 10 May 2020 Update (2004) is **not** supported on GPUs based on the Maxwell architecture. On GPUs based on an architecture later than the Maxwell architecture and earlier than the NVIDIA Blackwell architecture, this feature is supported only in pass-through mode.
>
> On GPUs based on the NVIDIA Blackwell architecture or a later architecture, hardware-accelerated GPU scheduling is supported for a vGPU on Windows 11 24H2 (build 26100) or a later Windows 11 release. The feature is enabled only for the Windows Display Driver Model (WDDM). It is **not** enabled for the Microsoft Compute Driver Model (MCDM) or the Tesla Compute Cluster (TCC) driver model.

2.3.2. Linux Guest OS Support

NVIDIA vGPU software supports **only** the Linux distributions listed as a guest OS on XenServer. The releases of XenServer for which a Linux release is supported depend on whether NVIDIA vGPU or pass-through GPU is used.

> **Note**
>
> If a specific release, even an update release, is not listed, it's **not** supported.
>
> XenMotion with vGPU is **not** supported on any Linux guest OS release.
>
> Rocky Linux releases that are compatible with supported Red Hat Enterprise Linux releases are also supported as a guest OS.

2.3.2.1 Linux Guest OS Support in Release 21.0

Guest OS	Wayland Support	X11 Support
Deprecated: CentOS Linux 8 (2105)	××	✓✓
Red Hat Enterprise Linux 9.8	×!	✓!
Red Hat Enterprise Linux 8.10	×!	✓!
Ubuntu 24.04 LTS	✓×	✓✓
Ubuntu 20.04 LTS	××	✓✓

✓✓ Supported by NVIDIA vGPU software and enabled by default in the OS.

✓× Supported by NVIDIA vGPU software but disabled by default in the OS and must be enabled.

✓! Supported by NVIDIA vGPU software but requires the **alternative** display server protocol to be disabled in the OS.

×× Not supported by NVIDIA vGPU software or the OS.

×! Not supported by NVIDIA vGPU software and must be disabled in the OS.

2.4. NVIDIA CUDA Toolkit Version Support

The releases in this release family of NVIDIA vGPU software support NVIDIA CUDA Toolkit 13.5.

To build a CUDA application, the system must have the NVIDIA CUDA Toolkit and the libraries required for linking. For details of the components of NVIDIA CUDA Toolkit, refer to NVIDIA CUDA Toolkit 13.5 Release Notes.

To run a CUDA application, the system must have a CUDA-enabled GPU and an NVIDIA display driver that is compatible with the NVIDIA CUDA Toolkit release that was used to build the application. If the application relies on dynamic linking for libraries, the system must also have the correct version of these libraries.

For more information about NVIDIA CUDA Toolkit, refer to CUDA Toolkit Documentation 13.5.

Note

If you are using NVIDIA vGPU software with CUDA on Linux, avoid conflicting installation methods by installing CUDA from a distribution-independent runfile package. Do not install CUDA from a distribution-specific RPM or Deb package.

To ensure that the NVIDIA vGPU software graphics driver is not overwritten when CUDA is installed, deselect the CUDA driver when selecting the CUDA components to install.

For more information, see NVIDIA CUDA Installation Guide for Linux.

2.5. Wayland Display Server Protocol Support

The Wayland display server protocol is supported with only a subset of supported GPUs, guest OS releases, and display resolutions.

2.5.1. Supported GPUs

All GPUs supported by NVIDIA vGPU software, **except** GPUs based on the NVIDIA Turing™ architecture.

2.5.2. Supported Guest OS Releases

Only Red Hat Enterprise Linux 10 guest OS releases supported by NVIDIA vGPU software.

- Ubuntu 26.04 LTS
- Ubuntu 24.04 LTS

2.5.3. Supported Display Resolutions

- 2560×1600
- 3840×2160
- 4096×2160
- 5120×2880
- 7680×4320

2.5.4. Limitations with Wayland Display Server Protocol Support

The following use cases are not supported:

- VDPAU
- Vulkan video playback
- Frame-rate limiting (FRL)

Console VNC is **not** supported on MIG-backed, time-sliced vGPUs. It is supported only on the following types of vGPUs:

- Time-sliced vGPUs on a single-instance GPU
- 1:1 MIG-backed vGPUs

2.5.5. Known Issues with Wayland Display Server Protocol Support

Refer to the online version of this document at Known Issues.

2.6. XenMotion with vGPU Support

XenMotion with vGPU is supported on all supported GPUs, but only on a subset of supported XenServer releases and guest operating systems.

2.6.1. Limitations with XenMotion with vGPU Support

vGPU migration is disabled for a VM for which unified memory is enabled.

Enabling NVIDIA CUDA Toolkit debuggers or profilers for a VM does **not** disable vGPU migration for the VM. Earlier restrictions on migrating a VM for which these tools are enabled no longer apply.

However, a VM cannot be migrated while a NVIDIA CUDA Toolkit debugger or profiler is actively performing an operation that would not survive migration:

- Profiling the system or an application
- Debugging an application

- Running Compute Sanitizer

Migration is permitted after the operation stops.

2.6.2. Supported Hypervisor Software Releases

XenServer 9 and XenServer 8.4

2.6.3. Supported Guest OS Releases

Windows only. XenMotion with vGPU is **not** supported on Linux.

2.6.4. Known Issues with XenMotion with vGPU Support

Use Case	Affected GPUs	Issue
Repeated migration of multiple vGPU-enabled VMs between XenServer 9 hosts	All GPUs that support XenMotion with vGPU	Migration of multiple vGPU-enabled VMs between XenServer 9 hosts might fail
Migration of a VM configured with NVIDIA vGPU software release 21.1 to a host running release 21.0	All GPUs that support XenMotion with vGPU	Migrating a VM configured with NVIDIA vGPU software release 20.1 to a host running release 20.0 fails
Simultaneous migration of multiple VMs	All GPUs that support XenMotion with vGPU	Hypervisor host reboots when multiple cloned VMs are simultaneously powered on or migrated
Migration between hosts with different ECC memory configuration	All GPUs that support XenMotion with vGPU	Migration of VMs configured with vGPU stops before the migration is complete

2.7. Multiple vGPU Support

To support applications and workloads that are compute or graphics intensive, multiple vGPUs can be added to a single VM. The assignment of more than one vGPU to a VM is supported only on a subset of vGPUs and hypervisor software releases.

2.7.1. vGPUs that Support Multiple vGPUs Assigned to a VM

Only Q-series vGPUs that are allocated all of the physical GPU's frame buffer are supported.

2.7.1.1 Multiple vGPU Support on the NVIDIA Blackwell Architecture

Board	vGPU
NVIDIA RTX PRO 6000 Blackwell Server Edition	
NVIDIA RTX PRO 6000 Blackwell Server Edition liquid cooled	NVIDIA RTX PRO 6000 Blackwell DC-96Q
NVIDIA RTX PRO 4500 Blackwell Server Edition	NVIDIA RTX PRO 4500 Blackwell DC-32Q

2.7.1.2 Multiple vGPU Support on the NVIDIA Ada Lovelace Architecture

Board	vGPU
NVIDIA L40S	L40S-48Q
NVIDIA L40	L40-48Q
NVIDIA L20	
NVIDIA L20 liquid cooled	L20-48Q
NVIDIA L4	L4-24Q
NVIDIA L2	L2-24Q
NVIDIA RTX 6000 Ada	RTX 6000 Ada-48Q
NVIDIA RTX 5880 Ada	RTX 5880 Ada-48Q
NVIDIA RTX 5000 Ada	RTX 5000 Ada-32Q

2.7.1.3 Multiple vGPU Support on the NVIDIA Ampere GPU Architecture

Board	vGPU
NVIDIA A40	A40-48Q[7]
NVIDIA A16	A16-16Q[7]
NVIDIA A10	A10-24Q[7]
NVIDIA A2	A2-16Q[7]
NVIDIA RTX A6000	A6000-48Q[7]
NVIDIA RTX A5500	A5500-24Q[7]
NVIDIA RTX A5000	A5000-24Q[7]

[7] This type of vGPU cannot be assigned with other types of vGPU to the same VM.

2.7.1.4 Multiple vGPU Support on the NVIDIA Turing GPU Architecture

Board	vGPU
Tesla T4	T4-16Q

2.7.2. Maximum Number of vGPUs Supported per VM

NVIDIA vGPU software supports up to a maximum of 16 vGPUs per VM.

2.7.3. Hypervisor Releases that Support Multiple vGPUs Assigned to a VM

All hypervisor releases that support NVIDIA vGPU software are supported.

2.8. Peer-to-Peer CUDA Transfers over NVLink Support

Peer-to-peer CUDA transfers enable device memory between vGPUs on different GPUs that are assigned to the same VM to be accessed from within the CUDA kernels. NVLink is a high-bandwidth interconnect that enables fast communication between such vGPUs. Peer-to-Peer CUDA transfers over NVLink are supported only on a subset of vGPUs, XenServer releases, and guest OS releases.

2.8.1. vGPUs that Support Peer-to-Peer CUDA Transfers

Only Q-series time-sliced vGPUs that are allocated all of the physical GPU's frame buffer on physical GPUs that support NVLink are supported.

2.8.1.1 Peer-to-Peer CUDA Transfer Support on the NVIDIA Ampere GPU Architecture

Board	vGPU
NVIDIA A40	A40-48Q
NVIDIA RTX A6000	A6000-48Q
NVIDIA RTX A5500	A5500-24Q
NVIDIA RTX A5000	A5000-24Q

2.8.1.2 Peer-to-Peer CUDA Transfer Support on the NVIDIA Turing GPU Architecture

Board	vGPU
Quadro RTX 6000	RTX6000-24Q
Quadro RTX 6000 passive	RTX6000P-24Q
Quadro RTX 8000	RTX8000-48Q
Quadro RTX 8000 passive	RTX8000P-48Q

2.8.1.3 Peer-to-Peer CUDA Transfer Support on the NVIDIA Volta GPU Architecture

Board	vGPU
Tesla V100 SXM2 32GB	V100DX-32Q
Tesla V100 SXM2	V100X-16Q

2.8.2. Hypervisor Releases that Support Peer-to-Peer CUDA Transfers

Peer-to-Peer CUDA transfers over NVLink are supported on all hypervisor releases that support the assignment of more than one vGPU to a VM. For details, see *Multiple vGPU Support*.

2.8.3. Guest OS Releases that Support Peer-to-Peer CUDA Transfers

Linux only. Peer-to-Peer CUDA transfers over NVLink are **not** supported on Windows.

2.8.4. Limitations on Support for Peer-to-Peer CUDA Transfers

- NVSwitch is not supported. Only direct connections are supported.
- PCIe is not supported.
- SLI is not supported.

2.9. Unified Memory Support

Unified memory is a single memory address space that is accessible from any CPU or GPU in a system. It creates a pool of managed memory that is shared between the CPU and GPU to provide a simple way to allocate and access data that can be used by code running on any CPU or GPU in the system. Unified memory is supported only on a subset of vGPUs and guest OS releases.

Note

Unified memory is disabled by default. If used, you must enable unified memory individually for each vGPU that requires it by setting a vGPU plugin parameter. NVIDIA CUDA Toolkit profilers are supported and can be enabled on a VM for which unified memory is enabled.

2.9.1. vGPUs that Support Unified Memory

On GPUs that support the MIG feature and on which this feature is enabled, **only** Q-series MIG-backed vGPUs that occupy an entire GPU instance are supported. All other MIG-backed vGPUs are **not** supported.

On single-instance GPUs, only Q-series vGPUs that are allocated all of the physical GPU's frame buffer on physical GPUs that support unified memory are supported.

2.9.1.1 Unified Memory Support on the NVIDIA Blackwell GPU Architecture

Board	vGPU
NVIDIA RTX PRO 6000 Blackwell Server Edition	
NVIDIA RTX PRO 6000 Blackwell Server Edition liquid cooled	NVIDIA RTX PRO 6000 Blackwell DC-96Q
All Q-series MIG-backed vGPUs that occupy an entire GPU instance	
NVIDIA RTX PRO 4500 Blackwell Server Edition	NVIDIA RTX PRO 4500 Blackwell DC-32Q
All Q-series MIG-backed vGPUs that occupy an entire GPU instance	

2.9.1.2 Unified Memory Support on the NVIDIA Ada Lovelace GPU Architecture

Board	vGPU
NVIDIA L40	L40-48Q
NVIDIA L40S	L40S-48Q
NVIDIA L20	
NVIDIA L20 liquid cooled	L20-48Q
NVIDIA L4	L4-24Q
NVIDIA L2	L2-24Q
NVIDIA RTX 6000 Ada	RTX 6000 Ada-48Q
NVIDIA RTX 5880 Ada	RTX 5880 Ada-48Q
NVIDIA RTX 5000 Ada	RTX 5000 Ada-32Q

2.9.1.3 Unified Memory Support on the NVIDIA Ampere GPU Architecture

Board	vGPU
NVIDIA A40	A40-48Q
NVIDIA A16	A16-16Q
NVIDIA A10	A10-24Q
NVIDIA A2	A2-16Q
NVIDIA RTX A6000	A6000-48Q
NVIDIA RTX A5500	A5500-24Q
NVIDIA RTX A5000	A5000-24Q

2.9.2. Guest OS Releases that Support Unified Memory

Linux only. Unified memory is **not** supported on Windows.

2.9.3. Limitations on Support for Unified Memory

- Only Q-series vGPUs that are allocated all of the physical GPU's frame buffer on physical GPUs that support unified memory are supported. Fractional time-sliced vGPUs are **not** supported.
- When unified memory is enabled for a VM, XenMotion with vGPU is disabled for the VM.

2.10. Microsoft Compute Driver Model (MCDM) Support

MCDM is supported only on a subset of vGPUs, GPUs, and guest operating systems.

If you want to use MCDM, you must enable it explicitly as explained in Enabling MCDM.

2.10.1. Supported vGPUs

Only Q-series vGPUs are supported. B-series and A-series vGPUs are **not** supported.

2.10.2. Supported GPUs

MCDM is supported only on GPUs based on the NVIDIA Ampere architecture and later architectures.

2.10.3. Supported Guest OS Releases

- Windows 11 24H2 (build 26100) or a later Windows 11 release
- Windows Server 2025

2.11. NVIDIA Deep Learning Super Sampling (DLSS) Support

NVIDIA vGPU software supports NVIDIA DLSS on NVIDIA RTX Virtual Workstation.

Supported DLSS versions: 2.0. Version 1.0 is **not** supported.

Supported GPUs:

- NVIDIA L40
- NVIDIA L40S
- NVIDIA L20
- NVIDIA L20 liquid cooled
- NVIDIA L4
- NVIDIA L2
- NVIDIA RTX 6000 Ada
- NVIDIA RTX 5880 Ada
- NVIDIA RTX 5000 Ada
- NVIDIA A40
- NVIDIA A16
- NVIDIA A2
- NVIDIA A10
- NVIDIA RTX A6000
- NVIDIA RTX A5500
- NVIDIA RTX A5000
- NVIDIA RTX PRO 6000 Blackwell Server Edition
- NVIDIA RTX PRO 6000 Blackwell Server Edition liquid cooled
- NVIDIA RTX PRO 4500 Blackwell Server Edition
- Tesla T4

Note

NVIDIA graphics driver components that DLSS requires are installed only if a supported GPU is detected during installation of the driver. Therefore, if the creation of VM templates includes driver installation, the template should be created from a VM that is configured with a supported GPU while the driver is being installed.

Supported applications: only applications that use `nvngx_dlss.dll` version 2.0.18 or newer

Chapter 3. Known Product Limitations

Known product limitations for this release of NVIDIA vGPU software are described in the following sections.

3.1. vGPUs of different types on the same GPU are not supported

XenServer does not support a mixture of different types of time-sliced vGPUs on the same physical GPU. All vGPUs on a single physical GPU must belong to the same vGPU series and be allocated the same amount of frame buffer.

3.2. Maximum Allowed Network Adapters on a VM

If a VM is configured with too many network adapters, the VM might fail to acquire or return a license. The exact number of network adapters allowed on a VM depends on your system. In testing, it was verified that a VM with **40** network adapters could successfully acquire a license.

If a VM fails to acquire or return a license because the VM is configured with too many network adapters, the following error message is written to the licensing event log file:

```
Failed to update local trusted store - Maximum buffer size exceeded
```

For information about how to recover from such a failure, refer to Virtual GPU Software Client Licensing User Guide.

3.3. NVENC does not support resolutions greater than 4096×4096

3.3.1. Description

The NVIDIA hardware-based H.264 video encoder (NVENC) does not support resolutions greater than 4096×4096. This restriction applies to all NVIDIA GPU architectures and is imposed by the GPU encoder hardware itself, not by NVIDIA vGPU software. The maximum supported resolution for each

encoding scheme is listed in the documentation for NVIDIA Video Codec SDK. This limitation affects any remoting tool where H.264 encoding is used with a resolution greater than 4096×4096. Most supported remoting tools fall back to software encoding in such scenarios.

3.3.2. Workaround

Use H.265 encoding. H.265 is more efficient than H.264 encoding and has a maximum resolution of 8192×8192.

> **Note**
>
> Resolutions greater than 4096×4096 are supported only by the H.265 decoder that 64-bit client applications use. The H.265 decoder that 32-bit applications use supports a maximum resolution of 4096×4096.

Because the client-side Workspace App on Windows is a 32-bit application, resolutions greater than 4096×4096 are not supported for Windows clients of Citrix Virtual Apps and Desktops. Therefore, if you are using a Windows client with Citrix Virtual Apps and Desktops, ensure that you are using H.264 hardware encoding with the default Use video codec for compression Citrix graphics policy setting, namely **Actively Changing Regions**. This policy setting encodes only actively changing regions of the screen (for example, a window in which a video is playing). Provided that the number of pixels along any edge of the actively changing region does not exceed 4096, H.264 encoding is offloaded to the NVENC hardware encoder.

3.4. Nested Virtualization Is Not Supported by NVIDIA vGPU

In general, NVIDIA vGPU deployments do not support nested virtualization, that is, running a hypervisor in a guest VM. For example, enabling the Hyper-V role in a guest VM running the Windows Server OS is **not** supported because it entails enabling nested virtualization. Similarly, enabling Windows Hypervisor Platform is not supported because it requires the Hyper-V role to be enabled.

3.5. Issues occur when the channels allocated to a vGPU are exhausted

3.5.1. Description

Issues occur when the channels allocated to a vGPU are exhausted and the guest VM to which the vGPU is assigned fails to allocate a channel to the vGPU. A physical GPU has a fixed number of channels and the number of channels allocated to each vGPU is inversely proportional to the maximum number of vGPUs allowed on the physical GPU.

When the channels allocated to a vGPU are exhausted and the guest VM fails to allocate a channel, the following errors are reported on the hypervisor host or in an NVIDIA bug report:

```
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0): Guest
 ↪attempted to allocate channel above its max channel limit 0xfb
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0): VGPU
 ↪message 6 failed, result code: 0x1a
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):
 ↪0xc1d004a1, 0xff0e0000, 0xff0400fb, 0xc36f,
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):         0x1,
 ↪ 0xff1fe314, 0xff1fe038, 0x100b6f000, 0x1000,
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):
 ↪0x80000000, 0xff0e0200, 0x0, 0x0, (Not logged),
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0):         0x1,
 ↪ 0x0
Jun 26 08:01:25 srvxen06f vgpu-3[14276]: error: vmiop_log: (0x0): , 0x0
```

3.5.2. Workaround

Use a vGPU type with more frame buffer, thereby reducing the maximum number of vGPUs allowed on the physical GPU. As a result, the number of channels allocated to each vGPU is increased.

3.6. Total frame buffer for vGPUs is less than the total frame buffer on the physical GPU

Some of the physical GPU's frame buffer is used by the hypervisor on behalf of the VM for allocations that the guest OS would otherwise have made in its own frame buffer. The frame buffer used by the hypervisor is not available for vGPUs on the physical GPU. In NVIDIA vGPU deployments, frame buffer for the guest OS is reserved in advance, whereas in bare-metal deployments, frame buffer for the guest OS is reserved on the basis of the runtime needs of applications.

If error-correcting code (ECC) memory is enabled on a physical GPU that does not have HBM2 memory, the amount of frame buffer that is usable by vGPUs is further reduced. All types of vGPU are affected, not just vGPUs that support ECC memory.

On all GPUs that support ECC memory and, therefore, dynamic page retirement, additional frame buffer is allocated for dynamic page retirement. The amount that is allocated is inversely proportional to the maximum number of vGPUs per physical GPU. All GPUs that support ECC memory are affected, even GPUs that have HBM2 memory or for which ECC memory is disabled.

The approximate amount of frame buffer that NVIDIA vGPU software reserves can be calculated from the following formula:

`<max-reserved-fb> = <vgpu-profile-size-in-mb>÷16 + 16 + <ecc-adjustments> + <page-retirement-allocation> + <compression-adjustment>`

`<max-reserved-fb>`
: The maximum total amount of reserved frame buffer in Mbytes that is not available for vGPUs.

`<vgpu-profile-size-in-mb>`
: The amount of frame buffer in Mbytes allocated to a single vGPU. This amount depends on the vGPU type. For example, for the T4-16Q vGPU type, `<vgpu-profile-size-in-mb>` is 16384.

`<ecc-adjustments>`
: The amount of frame buffer in Mbytes that is not usable by vGPUs when ECC is enabled on a

physical GPU that does not have HBM2 memory.

- If ECC is enabled on a physical GPU that does not have HBM2 memory `<ecc-adjustments>` is `<fb-without-ecc>`/16, which is equivalent to 64 Mbytes for every Gbyte of frame buffer assigned to the vGPU. `<fb-without-ecc>` is total amount of frame buffer with ECC disabled.
- If ECC is disabled or the GPU has HBM2 memory, `<ecc-adjustments>` is 0.

`<page-retirement-allocation>`
The amount of frame buffer in Mbytes that is reserved for dynamic page retirement.

- On GPUs based on the NVIDIA Maxwell GPU architecture, `<page-retirement-allocation>` = 4÷`<max-vgpus-per-gpu>`.
- On GPUs based on NVIDIA GPU architectures **after** the Maxwell architecture, `<page-retirement-allocation>` = 128÷`<max-vgpus-per-gpu>`

`<max-vgpus-per-gpu>`
The maximum number of vGPUs that can be created simultaneously on a physical GPU. This number varies according to the vGPU type. For example, for the T4-16Q vGPU type, `<max-vgpus-per-gpu>` is 1.

`<compression-adjustment>`
The amount of frame buffer in Mbytes that is reserved for the higher compression overhead in vGPU types with 12 Gbytes or more of frame buffer on GPUs based on the Turing architecture.

`<compression-adjustment>` depends on the vGPU type as shown in the following table.

vGPU Type	Compression Adjustment (MB)
T4-16Q T4-16C T4-16A	28

For all other vGPU types, `<compression-adjustment>` is 0.

Note

In VMs running Windows Server 2012 R2, which supports Windows Display Driver Model (WDDM) 1.<x>, an additional 48 Mbytes of frame buffer are reserved and not available for vGPUs.

3.7. Issues may occur with graphics-intensive OpenCL applications on vGPU types with limited frame buffer

3.7.1. Description

Issues may occur when graphics-intensive OpenCL applications are used with vGPU types that have limited frame buffer. These issues occur when the applications demand more frame buffer than is allocated to the vGPU.

For example, these issues may occur with the Adobe Photoshop and LuxMark LuxCoreRender applications:

- When the image resolution and size are changed in Adobe Photoshop, a program error may occur or Photoshop may display a message about a problem with the graphics hardware and a suggestion to disable OpenCL.
- When the LuxMark LuxCoreRender application is run, XID error 31 may occur.

3.7.2. Workaround

For graphics-intensive OpenCL applications, use a vGPU type with more frame buffer.

3.8. In pass through mode, all GPUs connected to each other through NVLink must be assigned to the same VM

3.8.1. Description

In pass through mode, all GPUs connected to each other through NVLink must be assigned to the same VM. If a subset of GPUs connected to each other through NVLink is passed through to a VM, unrecoverable error `XID 74` occurs when the VM is booted. This error corrupts the NVLink state on the physical GPUs and, as a result, the NVLink bridge between the GPUs is unusable.

3.8.2. Workaround

Restore the NVLink state on the physical GPUs by resetting the GPUs or rebooting the hypervisor host.

3.9. VM running an incompatible NVIDIA vGPU guest driver fails to initialize vGPU when booted

3.9.1. Description

A VM running a version of the NVIDIA guest VM driver that is incompatible with the current release of Virtual GPU Manager will fail to initialize vGPU when booted on a XenServer platform running that release of Virtual GPU Manager.

A guest VM driver is incompatible with the current release of Virtual GPU Manager in either of the following situations:

- The guest driver is from a release in a branch two or more major releases before the current release, for example release 9.4.

  In this situation, the XenServer VM's `/var/log/messages` log file reports the following error:

```
vmiop_log: (0x0): Incompatible Guest/Host drivers: Guest VGX version is
↪older than the minimum version supported by the Host. Disabling vGPU.
```

- The guest driver is from a later release than the Virtual GPU Manager.

  In this situation, the XenServer VM's `/var/log/messages` log file reports the following error:

```
vmiop_log: (0x0): Incompatible Guest/Host drivers: Guest VGX version is
↪newer than the maximum version supported by the Host. Disabling vGPU.
```

In either situation, the VM boots in standard VGA mode with reduced resolution and color depth. The NVIDIA virtual GPU is present in Windows Device Manager but displays a warning sign, and the following device status:

```
Windows has stopped this device because it has reported problems. (Code 43)
```

3.9.2. Resolution

Install a release of the NVIDIA guest VM driver that is compatible with current release of Virtual GPU Manager.

3.10. Single vGPU benchmark scores are lower than pass-through GPU

3.10.1. Description

A single vGPU configured on a physical GPU produces lower benchmark scores than the physical GPU run in pass-through mode.

Aside from performance differences that may be attributed to a vGPU's smaller frame buffer size, vGPU incorporates a performance balancing feature known as Frame Rate Limiter (FRL). On vGPUs that use the best-effort scheduler, FRL is enabled. On vGPUs that use the fixed share or equal share scheduler, FRL is disabled.

FRL is used to ensure balanced performance across multiple vGPUs that are resident on the same physical GPU. The FRL setting is designed to give good interactive remote graphics experience but may reduce scores in benchmarks that depend on measuring frame rendering rates, as compared to the same benchmarks running on a pass-through GPU.

3.10.2. Resolution

FRL is controlled by an internal vGPU setting. On vGPUs that use the best-effort scheduler, NVIDIA does not validate vGPU with FRL disabled, but for validation of benchmark performance, FRL can be temporarily disabled by specifying `frame_rate_limiter=0` in the `extra_args` parameter for the group to which the vGPU belongs:

```
[root@xenserver ~]# xe vgpu-param-set uuid=<vgpu-uuid> extra_args=frame_rate_
↪limiter=0
```

The setting takes effect the next time the VM is started or rebooted.

With this setting in place, the VM's vGPU will run without any frame rate limit. The FRL can be reverted back to its default setting in one of the following ways:

- Removing the `extra_args` key from the group to which the vGPU belongs
- Removing `frame_rate_limiter=0` from the `extra_args` or `vgpu_extra_args` key
- Setting `frame_rate_limiter=1`. For example:

```
[root@xenserver ~]# xe vgpu-param-set uuid=<vgpu-uuid> extra_args=frame_
↪rate_limiter=1
```

3.11. `nvidia-smi` fails to operate when all GPUs are assigned to GPU pass-through mode


3.11.1. Description

If all GPUs in the platform are assigned to VMs in pass-through mode, `nvidia-smi` will return an error:

```
[root@xenserver-vgx-test ~]# nvidia-smi
Failed to initialize NVML: Unknown Error
```

This is because GPUs operating in pass-through mode are not visible to `nvidia-smi` and the NVIDIA kernel driver operating in the XenServer dom0.

To confirm that all GPUs are operating in pass-through mode, use XenCenter's GPU tab to review current GPU assignment:

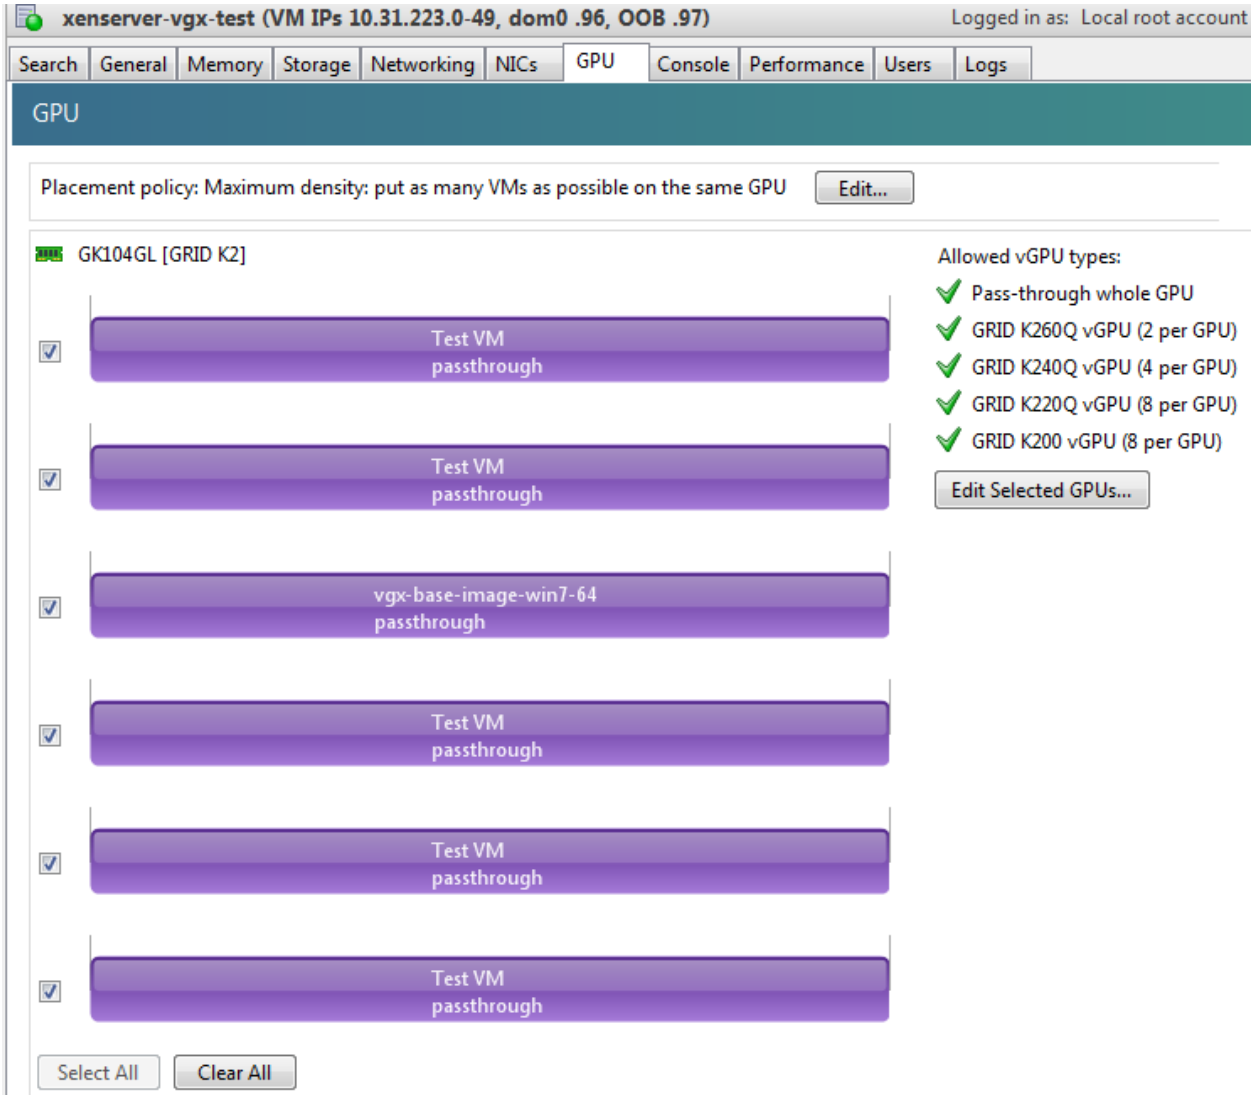

3.11.2. Resolution

N/A

3.12. Windows Aero is disabled on Citrix Virtual Apps and Desktops session using 3 or 4 monitors in 2560×1600 resolution

3.12.1. Description

Windows Aero may be disabled when Citrix Virtual Apps and Desktops is connected to a VM with a vGPU or passthrough GPU, with 3 or 4 monitors at 2560×1600 resolution.

This limitation is a limitation of Windows 7. For details, see the Microsoft knowledge base article Desktop background disappears with very large extended desktop on Windows 7.

3.13. VMs configured with large memory fail to initialize vGPU when booted

3.13.1. Description

When starting multiple VMs configured with large amounts of RAM (typically more than 32GB per VM), a VM may fail to initialize vGPU. In this scenario, the VM boots in standard VGA mode with reduced resolution and color depth. The NVIDIA vGPU software GPU is present in Windows Device Manager but displays a warning sign, and the following device status:

```
Windows has stopped this device because it has reported problems. (Code 43)
```

When this error occurs, `VGPU message failed` messages and XID error messages are written to the XenServer VM's `/var/log/messages` log file.

3.13.2. Resolution

vGPU reserves a portion of the VM's framebuffer for use in GPU mapping of VM system memory. The reservation is sufficient to support up to 32GB of system memory, and may be increased to accommodate up to 64GB by specifying `enable_large_sys_mem=1` in the vGPU's plugin parameters:

- **Citrix Hypervisor 8.1 or later:** Specify `enable_large_sys_mem=1` in the `extra_args` parameter for the group to which the vGPU belongs:

  ```
  [root@xenserver ~]# xe vgpu-param-set uuid=<vgpu-uuid> extra_args=enable_
  ↪large_sys_mem=1
  ```

- **Citrix Hypervisor earlier than 8.1:** Specify `enable_large_sys_mem=1` in the VM's `platform:vgpu_extra_args` parameter:

  ```
  [root@xenserver ~]# xe vm-param-set uuid=<vm-uuid> platform:vgpu_extra_
  ↪args="enable_large_sys_mem=1"
  ```

The setting takes effect the next time the VM is started or rebooted. With this setting in place, less GPU FB is available to applications running in the VM. To accommodate system memory larger than 64GB, the reservation can be further increased by specifying `extra_fb_reservation` in the VM's `platform:vgpu_extra_args` parameter, and setting its value to the desired reservation size in megabytes. The default value of 64M is sufficient to support 64GB of RAM. We recommend adding 2M of reservation for each additional 1GB of system memory. For example, to support 96GB of RAM, set `extra_fb_reservation` to 128:

```
extra_args="enable_large_sys_mem=1,extra_fb_reservation=128"
```

The reservation can be reverted back to its default setting in one of the following ways:

- Removing the `extra_args` key from the group to which the vGPU belongs
- Removing `enable_large_sys_mem` from the `extra_args` or `vgpu_extra_args` key
- Setting `enable_large_sys_mem=0`

3.14. vGPU host driver RPM upgrade fails

3.14.1. Description

Upgrading vGPU host driver RPM fails with an error message about failed dependencies on the console.

```
[root@xenserver ~]# rpm -U NVIDIA-vGPU-xenserver-6.5-352.46.x86_64.rpm
error: Failed dependencies:
       NVIDIA-vgx-xenserver conflicts with NVIDIA-vGPU-xenserver-6.5-352.46.
↪x86_64
[root@xenserver ~]#
```

3.14.2. Resolution

Uninstall the older vGPU RPM before installing the latest driver.

Use the following command to uninstall the older vGPU RPM:

```
[root@xenserver ~]# rpm -e NVIDIA-vgx-xenserver
```

Chapter 4. Resolved Issues

Only resolved issues that have been previously noted as known issues or had a noticeable user impact are listed. The summary and description for each resolved issue indicate the effect of the issue on NVIDIA vGPU software **before the issue was resolved**.

4.1. Issues Resolved in Release 21.2

No resolved issues are reported in this release for XenServer.

4.2. Issues Resolved in Release 21.1

No resolved issues are reported in this release for XenServer.

4.3. Issues Resolved in Release 21.0

No resolved issues are reported in this release for XenServer.

Chapter 5. Known Issues

Refer to the separate Known Issues document.

Chapter 6. Notices

Notice

This document is provided for information purposes only and shall not be regarded as a warranty of a certain functionality, condition, or quality of a product. NVIDIA Corporation ("NVIDIA") makes no representations or warranties, expressed or implied, as to the accuracy or completeness of the information contained in this document and assumes no responsibility for any errors contained herein. NVIDIA shall have no liability for the consequences or use of such information or for any infringement of patents or other rights of third parties that may result from its use. This document is not a commitment to develop, release, or deliver any Material (defined below), code, or functionality.

NVIDIA reserves the right to make corrections, modifications, enhancements, improvements, and any other changes to this document, at any time without notice.

Customer should obtain the latest relevant information before placing orders and should verify that such information is current and complete.

NVIDIA products are sold subject to the NVIDIA standard terms and conditions of sale supplied at the time of order acknowledgement, unless otherwise agreed in an individual sales agreement signed by authorized representatives of NVIDIA and customer ("Terms of Sale"). NVIDIA hereby expressly objects to applying any customer general terms and conditions with regards to the purchase of the NVIDIA product referenced in this document. No contractual obligations are formed either directly or indirectly by this document.

NVIDIA products are not designed, authorized, or warranted to be suitable for use in medical, military, aircraft, space, or life support equipment, nor in applications where failure or malfunction of the NVIDIA product can reasonably be expected to result in personal injury, death, or property or environmental damage. NVIDIA accepts no liability for inclusion and/or use of NVIDIA products in such equipment or applications and therefore such inclusion and/or use is at customer's own risk.

NVIDIA makes no representation or warranty that products based on this document will be suitable for any specified use. Testing of all parameters of each product is not necessarily performed by NVIDIA. It is customer's sole responsibility to evaluate and determine the applicability of any information contained in this document, ensure the product is suitable and fit for the application planned by customer, and perform the necessary testing for the application in order to avoid a default of the application or the product. Weaknesses in customer's product designs may affect the quality and reliability of the NVIDIA product and may result in additional or different conditions and/or requirements beyond those contained in this document. NVIDIA accepts no liability related to any default, damage, costs, or problem which may be based on or attributable to: (i) the use of the NVIDIA product in any manner that is contrary to this document or (ii) customer product designs.

No license, either expressed or implied, is granted under any NVIDIA patent right, copyright, or other NVIDIA intellectual property right under this document. Information published by NVIDIA regarding third-party products or services does not constitute a license from NVIDIA to use such products or services or a warranty or endorsement thereof. Use of such information may require a license from a

third party under the patents or other intellectual property rights of the third party, or a license from NVIDIA under the patents or other intellectual property rights of NVIDIA.

Reproduction of information in this document is permissible only if approved in advance by NVIDIA in writing, reproduced without alteration and in full compliance with all applicable export laws and regulations, and accompanied by all associated conditions, limitations, and notices.

THIS DOCUMENT AND ALL NVIDIA DESIGN SPECIFICATIONS, REFERENCE BOARDS, FILES, DRAWINGS, DIAGNOSTICS, LISTS, AND OTHER DOCUMENTS (TOGETHER AND SEPARATELY, "MATERIALS") ARE BEING PROVIDED "AS IS." NVIDIA MAKES NO WARRANTIES, EXPRESSED, IMPLIED, STATUTORY, OR OTHERWISE WITH RESPECT TO THE MATERIALS, AND EXPRESSLY DISCLAIMS ALL IMPLIED WARRANTIES OF NONINFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE. TO THE EXTENT NOT PROHIBITED BY LAW, IN NO EVENT WILL NVIDIA BE LIABLE FOR ANY DAMAGES, INCLUDING WITHOUT LIMITATION ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, PUNITIVE, OR CONSEQUENTIAL DAMAGES, HOWEVER CAUSED AND REGARDLESS OF THE THEORY OF LIABILITY, ARISING OUT OF ANY USE OF THIS DOCUMENT, EVEN IF NVIDIA HAS BEEN ADVISED OF THE POSSIBILITY OF SUCH DAMAGES. Notwithstanding any damages that customer might incur for any reason whatsoever, NVIDIA's aggregate and cumulative liability towards customer for the products described herein shall be limited in accordance with the Terms of Sale for the product.

VESA DisplayPort

DisplayPort and DisplayPort Compliance Logo, DisplayPort Compliance Logo for Dual-mode Sources, and DisplayPort Compliance Logo for Active Cables are trademarks owned by the Video Electronics Standards Association in the United States and other countries.

HDMI

HDMI, the HDMI logo, and High-Definition Multimedia Interface are trademarks or registered trademarks of HDMI Licensing LLC.

OpenCL

OpenCL is a trademark of Apple Inc. used under license to the Khronos Group Inc.

Trademarks

NVIDIA, the NVIDIA logo, NVIDIA GRID, NVIDIA GRID vGPU, NVIDIA Maxwell, NVIDIA Pascal, NVIDIA Turing, NVIDIA Volta, GPUDirect, Quadro, and Tesla are trademarks or registered trademarks of NVIDIA Corporation in the U.S. and other countries. Other company and product names may be trademarks of the respective companies with which they are associated.

Copyright

©2013-2026, NVIDIA Corporation